



YOUR INSPECTION REPORT

Inspection, Education, Knowledge.

PREPARED BY:
ADAM HANNAN



FOR THE PROPERTY AT:
915 Ossington Avenue
Toronto, ON M6G 3V3

PREPARED FOR:
GILLIAN RITCHIE

INSPECTION DATE:
Friday, February 18, 2022

TIP

THE
INSPECTION
PROFESSIONALS

THE INSPECTION PROFESSIONALS, INC.
3120 Rutherford Rd.
Concord, ON L4K 0B2

416-725-5568
HST# 89249 4501 RT0001

www.inspectionpros.ca
adam@inspectionpros.ca





February 22, 2022

Dear Gillian Ritchie,

RE: Report No. 7026, v.2
915 Ossington Avenue
Toronto, ON
M6G 3V3

Thank you for choosing The Inspection Professionals to perform your Property Inspection. You can navigate the report by clicking the tabs at the top of each page. The Reference tab includes a 500-page Reference Library.

The Inspection Professionals (TIP) is a certified multi-inspector award-winning company founded by Adam Hannan. Since 2006, Adam has performed thousands of residential and commercial inspections and has become a respected expert in his field. Adam has a passion for education and has been an inspection instructor teaching at Community Colleges and Universities since 2009.

Adam is a member of the International Association of Certified Home Inspectors (CPI # NACHI07020704)

"We inspect every home as if we were buying it for ourselves. We care about our clients and we strive to exceed expectations. We offer a professional unbiased opinion of the current performance of the home regardless of who we are working for."

-Adam

BUYERS -

A phone review of the current report is available to prospective buyers. In order to more thoroughly familiarize yourself with the property and our findings, please book a Phone Review at your convenience by calling (416) 725-5568. The fee for this service is only \$195.

Sincerely,

ADAM HANNAN
on behalf of
THE INSPECTION PROFESSIONALS, INC.

THE INSPECTION PROFESSIONALS,
INC.
3120 Rutherford Rd.
Concord, ON L4K 0B2
416-725-5568
HST# 89249 4501 RT0001
www.inspectionpros.ca
adam@inspectionpros.ca

SUMMARY

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

HIGHLIGHTS:

This solid masonry on stone foundations home is in very good condition overall as compared to homes of similar age and style. The home has undergone extensive renovations in the past. The electrical system features a 100-amp electrical service with upgraded copper wiring throughout. The heating system features a high efficient boiler/tankless combo manufactured in 2010. The masonry at exterior wall is in good condition overall. The split ductless air conditioner system features 5 interior units, all less than 5 years old. The basement has been professionally remodeled. Insulation improvements have been performed at walls as noted per seller. Both the exterior and interior of the home appear well maintained. As is typical for homes of this age, there is a mix of newer and older systems and components

This Summary outlines some of the potentially short-term significant issues from a cost standpoint. This section is provided as a COURTESY ONLY and cannot be considered a substitute for reading the entire report. Please read the complete document.

It is not possible for a home inspector to predict the future. It would be advisable to annually budget between 0.5% to 1% of the value of the home for unforeseen repairs and maintenance. This would hold true for any house that you were considering.

Things will wear out, break down, and fail without warning. This is a fact of home ownership.

We adhere to the CAHPI Standards of Practice which can be viewed here:

[CAHPI_2012_Standards_of_Practice_verf-aug_22_final_ver041519.pdf](#)

NOTE: ALL ELECTRICAL ISSUES ARE CONSIDERED PRIORITY ITEMS

NOTE: FOR BALLPARK COSTS THE TERM 'MINOR' REFERS TO COSTS UNDER \$500

NOTE: FOR DIRECTIONAL PURPOSES USED THROUGHOUT THE REPORT, THE "FRONT" OF THE HOUSE IS REFERENCED AS FACING THE FRONT DOOR FROM THE EXTERIOR.

During a home inspection we inspect all visible systems and components. There are literally hundreds of potential minor issues found in every home, new and old. The inspection is not a technical audit on every minor flaw or deficiency. A technical audit can be performed at an additional cost. The focus of this inspection was to identify MAJOR issues with major systems and components. To simplify and give you a better understanding of what is considered a major issue, the inspection can generally be categorized as follows:

- 1)OBSERVABLE STRUCTURAL DEFECTS
- 2)OBSERVABLE WATER LEAKAGE/DAMAGE Roof, Plumbing, and basement moisture intrusion.
- 3)OBSERVABLE ELECTRICAL DEFECTS
- 4)LIFESPAN SYSTEMS- Roof Covering, Heating System, Cooling System, Windows

Disclaimer / Note to prospective buyers: This inspection report was performed for our client(s) as named on the report. We take no responsibility or hold no liability until an onsite review is purchased by the buyer and an onsite review is performed by our company and our inspection agreement of limitations and liability are signed. By accepting the

SUMMARY

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

information in this report without our onsite review, you are waiving all rights.

For Ballpark costs of various home components, please click here:

<http://www.inspectionlibrary.com/costs.htm>

Roofing

RECOMMENDATIONS \ Overview

Condition: • Snow on roof limited/restricted inspection. Inspect roof in the Spring when the snow has melted.

This concludes the Summary section.

The remainder of the report describes each of the home's systems and also details any recommendations we have for improvements. Limitations that restricted our inspection are included as well.

The suggested time frames for completing recommendations are based on the limited information available during a home inspection. These may have to be adjusted based on the findings of specialists.

<http://www.inspectionlibrary.com/wtgw.htm>

ROOFING

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Descriptions

Sloped roofing material: • [Asphalt shingles](#)

Flat roofing material:

• Unknown
snow covered

Approximate age: • Not Determined

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Roofing issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes.

RECOMMENDATIONS \ Overview

Condition: • Snow on roof limited/restricted inspection. Inspect roof in the Spring when the snow has melted.

Inspection Methods and Limitations

General: • Most roofs are susceptible to ice damming under the right weather conditions. This is where ice forms at the lower edge of a sloped roof, causing melting water from above to back up under the shingles. We cannot predict which roofs will suffer the most damage under adverse weather

Roof inspection limited/prevented by: • Snow/ice/frost

Inspection performed: • Not viewed. Snow on sloped and flat roofs

EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Descriptions

General: • The exterior has been well maintained overall

Gutter & downspout material: • [Aluminum](#)

Gutter & downspout discharge: • [Below grade](#) • [Above grade](#)

Wall surfaces and trim: • [Vinyl siding](#)

Wall surfaces - masonry: • [Brick](#)

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Exterior issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes, and personal safety.

ROOF DRAINAGE \ Downspouts

Condition: • [Discharge onto roofs](#)

Improvement recommendation. Extend Downspout to lower gutter to protect roof from premature wear.

Location: Front Exterior Roof

Task: Improve

Time: Less than 1 year

Cost: Minor

Downspout running across roof

installing a downspout (from the secondary roof to the main gutter below) helps prevent localized roof wear



EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE



1. Discharge onto roofs

Condition: • Downspouts below grade - Toronto.

For more information visit:

<https://www.toronto.ca/services-payments/water-environment/managing-rain-melted-snow/basement-flooding/mandatory-downspout-disconnection-exemption-aoda.pdf>

For exemptions visit here:

<https://www.toronto.ca/wp-content/uploads/2018/01/9516-15-0028-Mandatory-Downspout-Disconnection-Exemption-AODA.pdf>

Location: Exterior

Task: Improve

Time: As Required



2. Downspouts below grade - Toronto. For more...



3. Downspouts below grade - Toronto. For more...

WALLS \ Masonry (brick, stone) and concrete

Condition: • [Spalling](#)

Spalling and mortar deterioration at various areas of brick. Repair / Replace / Tuck point masonry. This is regular maintenance for a home of this age.

EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO


APPENDIX

REFERENCE

Location: Various Exterior Wall

Task: Repair

Time: Regular maintenance

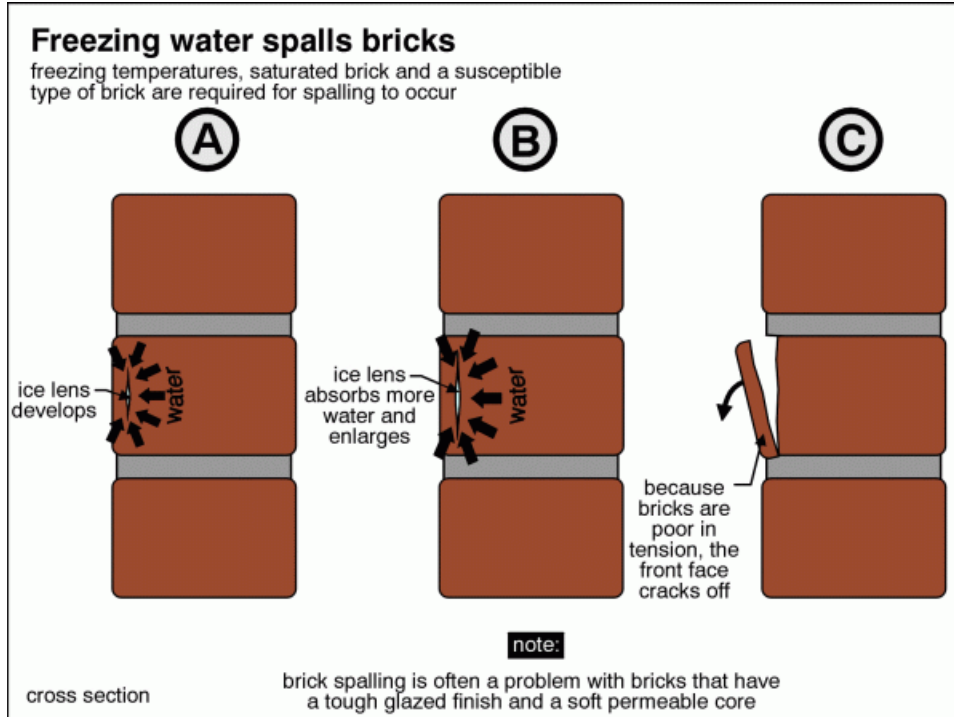

4. Spalling example

Condition: • Most masonry walls have small cracks due to shrinkage or minor settlement. These will not be individually noted in the report, unless leakage, building movement or similar problems are noted

Location: Various Exterior Wall

EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

DOORS \ General notes

Condition: • [Air leaks](#)

Location: Front Basement

Task: Improve weatherstripping

Time: As Needed

Cost: Minor Regular maintenance item



5. Air leaks

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

Condition: • Inspect when snow melts. Improve as needed.

BASEMENT WALKOUTS \ General notes

Condition: • [Guard and handrail problems](#)

Location: Rear Exterior

Task: Provide handrail

Time: Less than 1 year

Cost: Minor

EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE




6. handrail needed

Condition: • [Door threshold missing, too low, not watertight](#)

Location: Rear Exterior Door Threshold

Task: Monitor / Improve

Time: If necessary

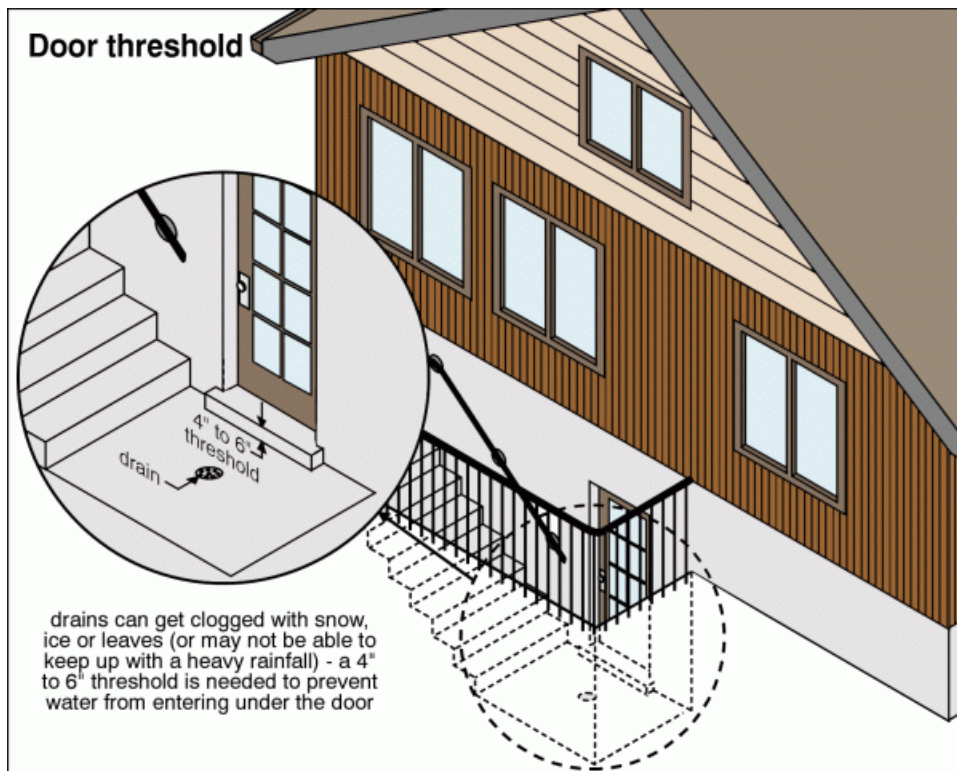

EXTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE



7. Door threshold too low

LANDSCAPING \ Lot grading

Condition: • When the snow melts, ensure that the grading around the home is promoting drainage of water away from the home.

Inspection Methods and Limitations

Inspection limited/prevented by: • Snow / ice / frost

Upper floors inspected from: • Ground level

Descriptions

General: • No significant structural performance issues were observed.

Configuration: • [Basement](#)

Foundation material: • [Stone](#)

Floor construction: • [Joists](#)

Exterior wall construction: • [Masonry](#)

Roof and ceiling framing: • Not visible

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Structure issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes, and personal safety.

WALLS \ Solid masonry walls

Condition: • [Prior repairs](#)

It is common to find a multitude of wall repairs on homes of this age

Location: Various Exterior Wall

Task: For Your Information

Inspection Methods and Limitations

Inspection limited/prevented by: • Finishes, insulation, furnishings and storage conceal structural components.

Attic/roof space: • The attic has been converted to a living space at some point in past.

The roof space (the small area between the ceiling and roof cannot be viewed during an inspection)

Descriptions

General: • ALL ELECTRICAL CONDITIONS ARE CONSIDERED PRIORITY ITEMS • The Electrical system has been updated and is in good condition overall.

Service entrance cable and location: • [Overhead - cable type not determined](#)

Service size: • [100 Amps \(240 Volts\)](#)

Main disconnect/service box type and location: • [Breakers - basement](#)

System grounding material and type: • [Copper - water pipe](#)

Distribution panel type and location: • [Breakers - basement](#)

Distribution panel rating: • [125 Amps](#)

Distribution wire (conductor) material and type: • [Copper - non-metallic sheathed](#)

Type and number of outlets (receptacles): • [Grounded - upgraded](#)

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • [GFCI - bathroom and exterior](#)

Smoke alarms (detectors): • [Present](#)

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All electrical recommendations are safety issues. POTENTIAL worst-case implications are fire and shock hazards. Treat them as high priority items, and consider the time frame as Immediate, unless otherwise noted.

SERVICE BOX, GROUNDING AND PANEL \ Panel wires

Condition: • White wires connected to breakers not identified as hot/live/ungrounded


White wire used as hot wire not marked (likely used for A/C unit)

Location: Basement Panel

Task: Correct

Time: As Soon As Possible

Cost: Less than \$200

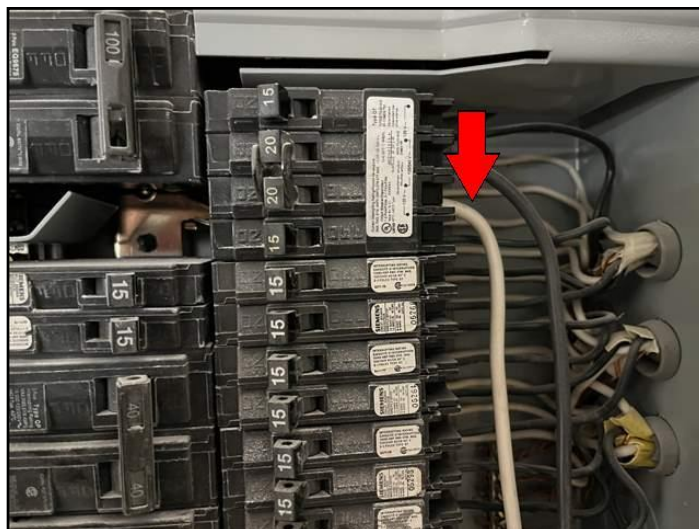

8. White wires connected to breakers not...

DISTRIBUTION SYSTEM \ Wiring (wires) - damaged or exposed

Condition: • [Exposed on walls or ceilings](#)

Location: Staircase

Task: Correct / Provide conduit

Time: Less than 1 year



9. Exposed on walls or ceilings



10. Exposed on walls or ceilings



11. Exposed on walls or ceilings

DISTRIBUTION SYSTEM \ Outlets (receptacles)

Condition: • [Loose](#)

Location: First Floor Kitchen

Task: Correct

Time: Prior to first use

Cost: Regular maintenance item



12. Loose


Condition: • [GFCI/GFI needed \(Ground Fault Circuit Interrupter\)](#)

Location: Basement Bathroom

Task: Replace

Time: As Soon As Possible

Cost: Minor

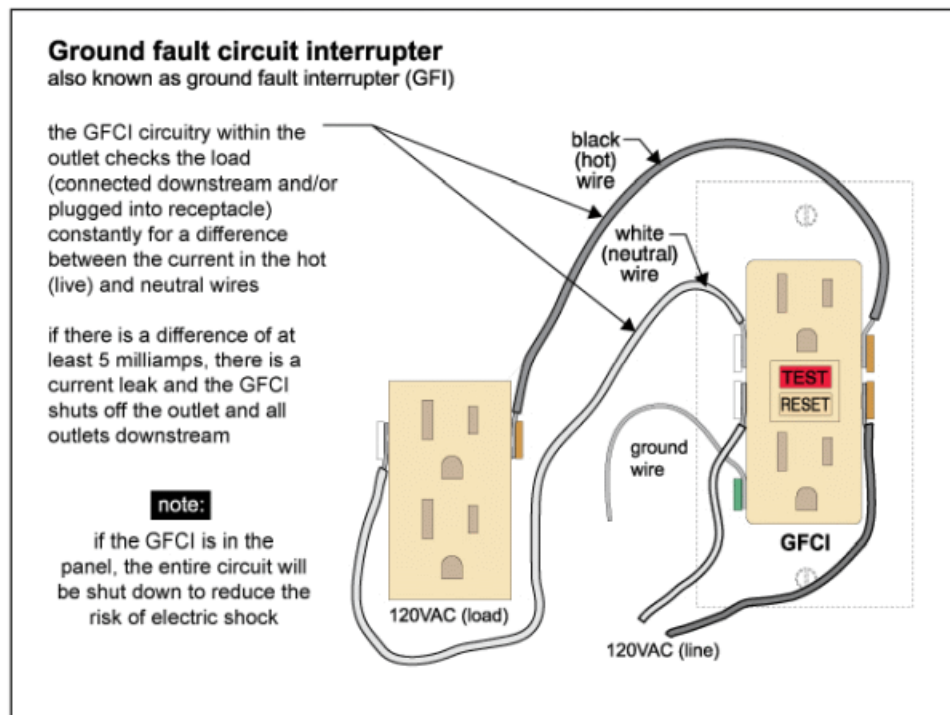



13. GFCI/GFI needed (Ground Fault Circuit...

DISTRIBUTION SYSTEM \ Cover plates

Condition: • For switch is missing

Location: Basement Boiler Room

Task: Provide Cover

Time: As Soon As Possible

Cost: Less than \$100



14. For switch is missing

Condition: • For outlet (receptacle) is missing

Location: Front Basement Laundry Area

Task: Provide Cover

Time: As Soon As Possible

Cost: Less than \$100



15. For outlet (receptacle) is missing

DISTRIBUTION SYSTEM \ Smoke alarms (detectors)

Condition: • Smoke and carbon monoxide (CO) detectors should be provided at every floor level of every home. Smoke detectors should be close to sleeping areas, and carbon monoxide detectors should be in any room with a wood-burning stove or fireplace. These devices are not tested as part of a home inspection. Once you take possession of the home, detectors should be tested regularly, and replaced every 10 years. If unsure of the age of a smoke detector, it should be replaced. Smoke detector batteries should be replaced annually.

Inspection Methods and Limitations

General: • The electrical system has been upgraded at some point. Knob and Tube wiring was the typical wiring used in homes built prior to 1950. We did not observe any knob and tube during our inspection and all the outlets we tested appeared grounded and in good working order. Sometimes remnants of knob and tube wiring is found during renovations. If found, remove during renovations.

System ground: • Quality of ground not determined

Descriptions

Heating system type:

- [Boiler](#)
- [Integrated \(Combination\) system](#)



16. Boiler/Tankless with cover removed

Fuel/energy source: • [Gas](#)

Heat distribution: • [Radiators](#)

Efficiency: • [High-efficiency](#)

Approximate age: • [12 years](#)

Typical life expectancy: • Integrated (Combination) system using boiler - 10 to 20 years

Fireplace/stove: • Wood-burning fireplace - not in service

Observations and Recommendations

GAS HOT WATER BOILER \ General

Condition: • Service Boiler

Task: Service annually

GAS HOT WATER BOILER \ Life expectancy

Condition: • Aging

These combination boiler/water heater systems have a range of 10-20 year typical lifespans.

Location: Basement Boiler Room

Task: Service annually and Replace when necessary

Time: Unpredictable

Cost: \$3,500 - and up

CHIMNEY AND VENT \ Masonry chimney

Condition: • [Settling or leaning](#)

HEATING

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Masonry deterioration and minor leaning observed. If you have no plans to restore and use wood fireplace, consider removing altogether

Location: Exterior

Task: Remove



17. Settling or leaning

FIREPLACE \ General notes

Condition: • Not functional

Do not use wood fireplaces. If you plan to use in future, consult with chimney specialist and repair/upgrade fireplace, flue and chimney to modern standards.



18. Not functional

HEATING

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Inspection Methods and Limitations

Safety devices: • Not tested as part of a building inspection

Heat loss calculations: • Not done as part of a building inspection

Heat exchanger: • Not visible

COOLING & HEAT PUMP

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Descriptions

Air conditioning type:

- [Air cooled](#)
- [Ductless \(Mini split\) system](#)

There are 5 units at interior. We noted ages of 2017 and 2018. The seller verifies all interior units are less than 5 years old.

The age of the 2 exterior compressor units were not observed.

Typical life expectancy: • 10 to 15 years

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • In general, air conditioning units have a lifespan of 10-15 years but often last longer with regular servicing.

RECOMMENDATIONS \ Overview

Condition: • No air conditioning or heat pump recommendations are offered as a result of this inspection.

Inspection Methods and Limitations

Inspection limited/prevented by: • Cooling systems are not operated when the outdoor temperature is below 60°F

Heat gain/loss calculations: • Not done as part of a building inspection

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Descriptions

Attic/roof insulation material: • Not visible

Attic/roof insulation amount/value: • [Not visible](#)

Attic/roof air/vapor barrier: • [Not visible](#)

Wall insulation material: • Seller noted that in 2018, they insulated the Roof space and walls on the main, second and third floors with spray foam insulation.

Foundation wall insulation material:

• [Glass fiber](#)

Not visible in most areas due to finishes. We noted fiberglass at areas near main water and hose shut off valves.

Observations and Recommendations

RECOMMENDATIONS \ Overview

Condition: • No insulation recommendations are offered as a result of this inspection.

Inspection Methods and Limitations

Inspection limited/prevented by lack of access to: • Walls, which were spot checked only

Roof ventilation system performance: • Not evaluated

Air/vapor barrier system: • Continuity not verified

Descriptions

Service piping into building: • [Not visible](#)

Supply piping in building:

- [Copper](#)
- [Not visible](#)

in most areas.

Main water shut off valve at the:

- Basement



19. Main water shut off valve

Water flow and pressure: • [Typical for neighborhood](#)

Water heater type:

- [Combination system](#)
- Combination boiler/tankless water heater manufactured 2010
- [Tankless/Indirect](#)

Water heater tank capacity: • Tankless / Instantaneous

Waste and vent piping in building: • [Plastic](#)

Floor drain location: • Near front of basement

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Plumbing issues have POTENTIAL worst-case implications of water damage to contents, finishes and/or structure.

SUPPLY PLUMBING \ Water supply piping in building

Condition: • [Poor pressure or flow](#)


The shower head pressure is very low when the toilet is flushed.

Location: Second Floor Bathroom

Task: Improve

Time: Discretionary

Factors affecting supply of water

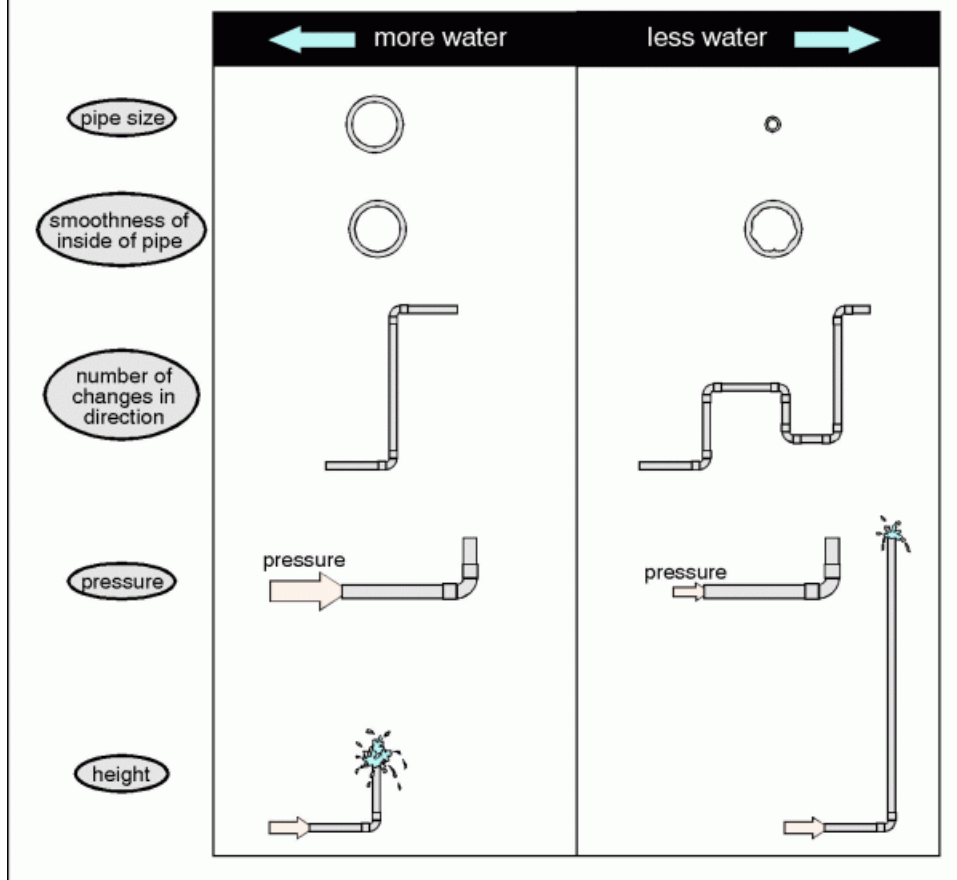



20. Poor pressure when toilet flushed

Condition: • Freezing Risk

Pipes near unheated spaces / adjacent to exterior walls are vulnerable to freezing. While relocation of the pipes is the best solution, adding insulation or heating cables may reduce the risk of freezing.

Location: Front Basement Laundry Area

Task: Monitor / Improve

Time: If necessary

WASTE PLUMBING \ Drain piping - performance

Condition: • Sewer backup insurance is recommended for ALL homes

Sewer backup can happen to any home. There are many potential causes and it is prudent for homeowners to have coverage for this.

Condition: • A videoscan of the waste plumbing is recommended to determine whether there are tree roots or other obstructions, and to look for damaged or collapsed pipe. This is common on older properties, especially where there are mature trees nearby. This is a great precautionary measure, although many homeowners wait until there are problems with the drains. The cost may be roughly \$200 to \$400.

GENERAL RECOMMENDATION FOR ALL HOMES BUILT PRIOR TO 1970

WASTE PLUMBING \ Traps - installation


Condition: • [Nonstandard shape or material](#)

Location: Second Floor Bathroom

Task: Replace

Time: If necessary

S-traps can lead to siphoning

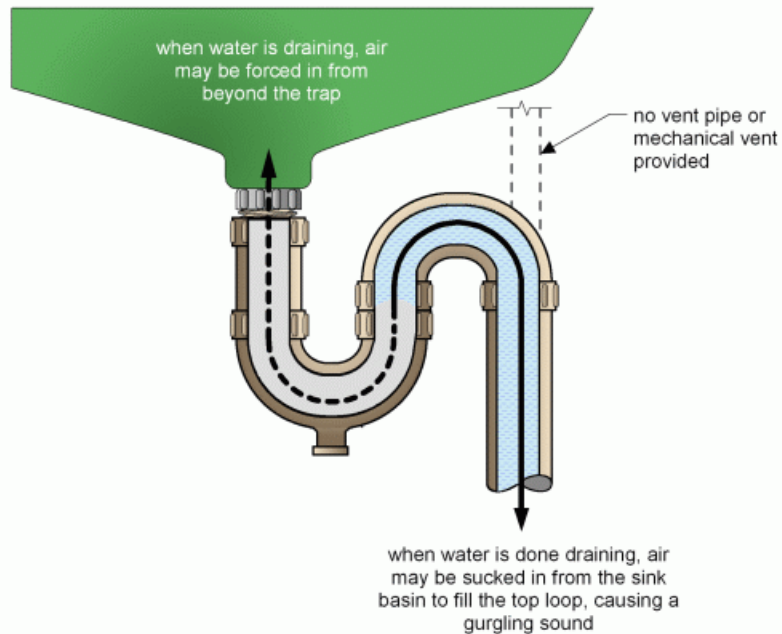

21. Nonstandard shape or material

WASTE PLUMBING \ Floor drain

Condition: • The floor drain in the basement shower is smaller than average.

Location: Basement Bathroom

Task: Improve

Time: If necessary



22.

FIXTURES AND FAUCETS \ Faucet

Condition: • [Drip, leak](#)

Water leaks from back of toe tester faucet

Location: Basement Bathroom

Task: Repair / Replace

Time: Less than 1 year

Cost: Minor



23. *Water drips down from faucet connection*

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Inspection Methods and Limitations

Items excluded from a building inspection: • Water quality • Isolating/relief valves & main shut-off valve • Concealed plumbing • Tub/sink overflows • Water treatment equipment • Tub and basin overflows are not tested as part of a home inspection. Leakage at the overflows is a common problem.

Descriptions

General: • The interior of the home is in good condition overall. • Many interior components have been updated

General: • Seller noted that basement has been dry through ownership with no major issues to report.

Major floor finishes: • [Hardwood](#) • [Laminate](#)

Major wall and ceiling finishes: • [Plaster/drywall](#) • [Stucco/texture/stipple](#)

Windows: • [Fixed](#) • [Single/double hung](#) • [Sliders](#) • [Awning](#)

Glazing: • [Single](#) • [Double](#) • [Primary plus storm](#)

Exterior doors - type/material: • Hinged

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Interior issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes, and personal safety.

Condition: • Typical minor flaws were noted on floors, walls and ceilings. These cosmetic issues reflect normal wear and tear

CEILINGS AND WALLS \ General notes

Condition: • Typical minor cracks/settlement noted along ceiling/wall intersection in some areas. These are very common in old homes

Location: Second and Third Floor

Task: Patch/Paint

Time: Discretionary

CEILINGS \ Plaster or drywall

Condition: • [Patched](#)

We noted patching and/or cracks at areas of ceilings at third floor and second floor bedrooms.

Given the home is 90+ years old, these may have been present for some time. We tested ALL patches with moisture meter and all were dry at time of inspection. Seller confirms all repairs are old, prior to their ownership.

Location: Second Floor / Third Floor Bedrooms

Task: For your information / Monitor



24. example from third floor.

FLOORS \ Subflooring

Condition: • Slope or Sag Noted.

Most older homes tend to have sagging or sloping floors. If you choose to make repairs to level the floors, repairs can require invasive and extensive work. Troubleshooting the specific cause is outside the scope of the inspection since it typically requires structural analysis of the floor components and/or foundations.

Task: Repair when desired or when remodelling

Cost: Depends on cause (Joists vs foundations, etc)

WINDOWS \ General notes

Condition: • Aging

We noted a variety of windows ages and styles. Many appear to be from 2017 and 2009. We also noted others from 1981, 1991, 1992. Some windows have been fitted with a new interior glass unit. We typically recommend immediate replacement of windows only when leaky or inoperative windows are found.

All the windows we tested were functional

Location: Various

Task: Upgrade

Time: Discretionary / As Needed

Cost: When needed \$70-\$100 per sq ft.

WINDOWS \ Glass (glazing)

Condition: • [Lost seal on double or triple glazing](#)

Location: Rear Second Floor Bedroom

Task: Replace

Time: Discretionary

Cost: \$300 - \$500

INTERIOR

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE



25. Lost seal on double or triple glazing

WINDOWS \ Hardware

Condition: • [Inoperative](#)

One of the double hung window locks does not latch. (on left latch)

Location: First Floor Window beside kitchen

Task: Repair or replace

Time: As Needed

CARPENTRY \ Cabinets

Condition: • [Not well secured to wall](#)

Location: Rear Kitchen

Task: Improve support

Time: Less than 1 year





26. Not well secured to wall

STAIRS \ Treads

Condition: • [Width too small](#)

Take caution when using staircase

Location: Basement Staircase

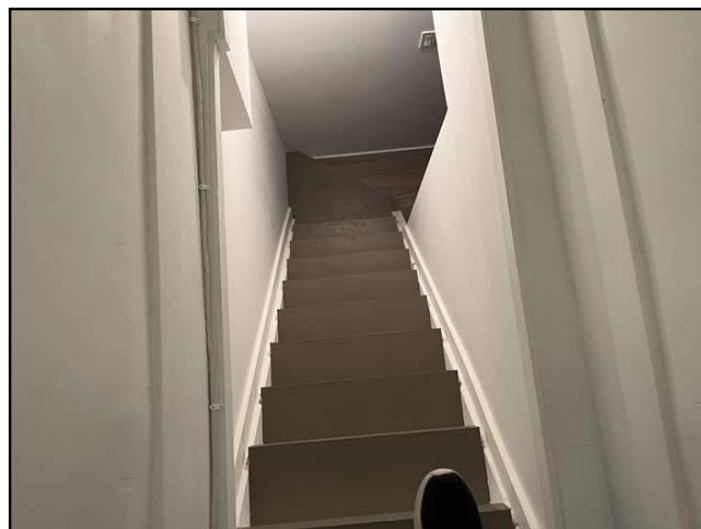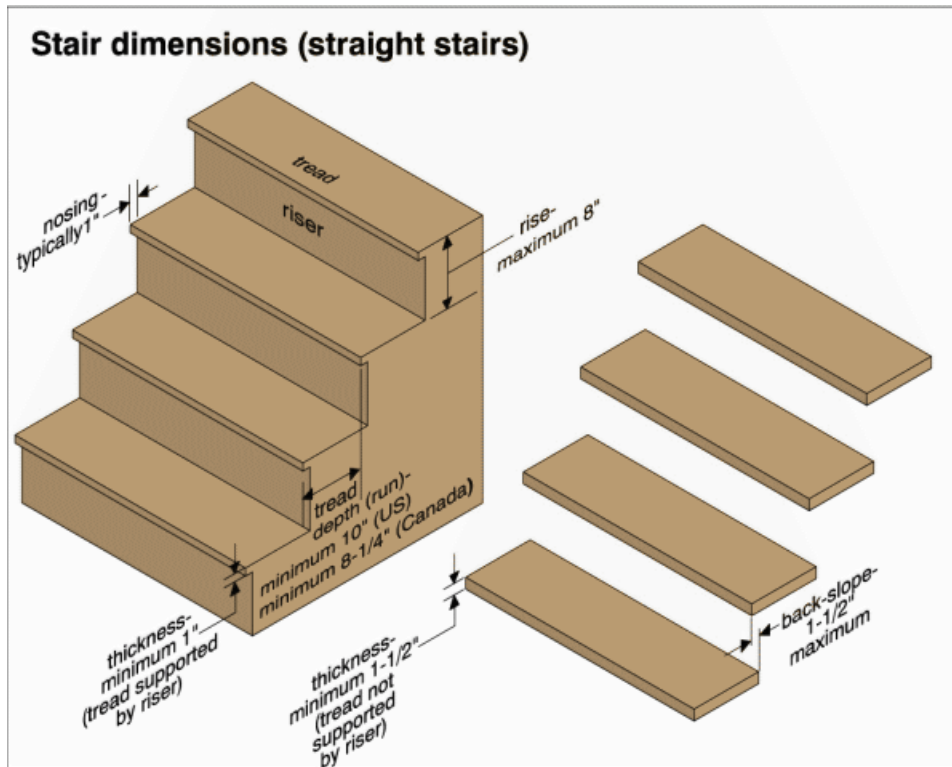

27. Width too small

STAIRS \ Handrails and guards


Condition: • [Missing](#)

Location: Basement Staircase

Task: Provide Handrail

Time: Less than 1 year

Cost: Minor

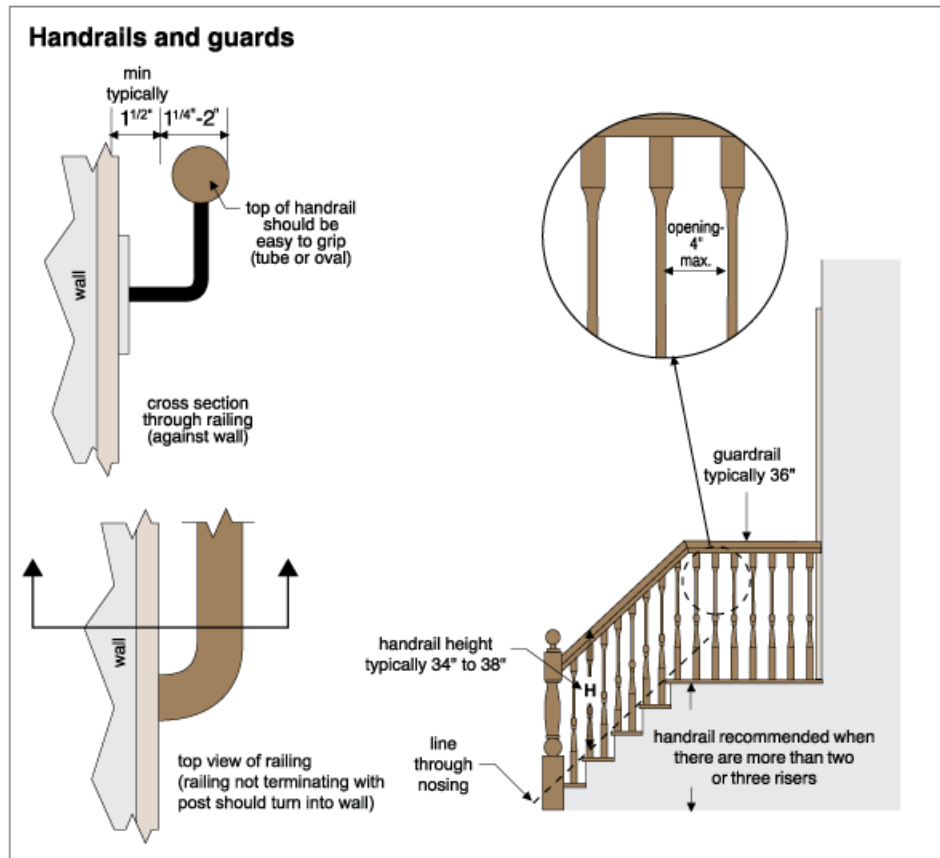

28. Missing

EXHAUST FANS \ General notes


Condition: • [Missing](#)

Location: Basement Bathroom

Task: Provide

Time: Less than 1 year

Cost: \$800 - and up

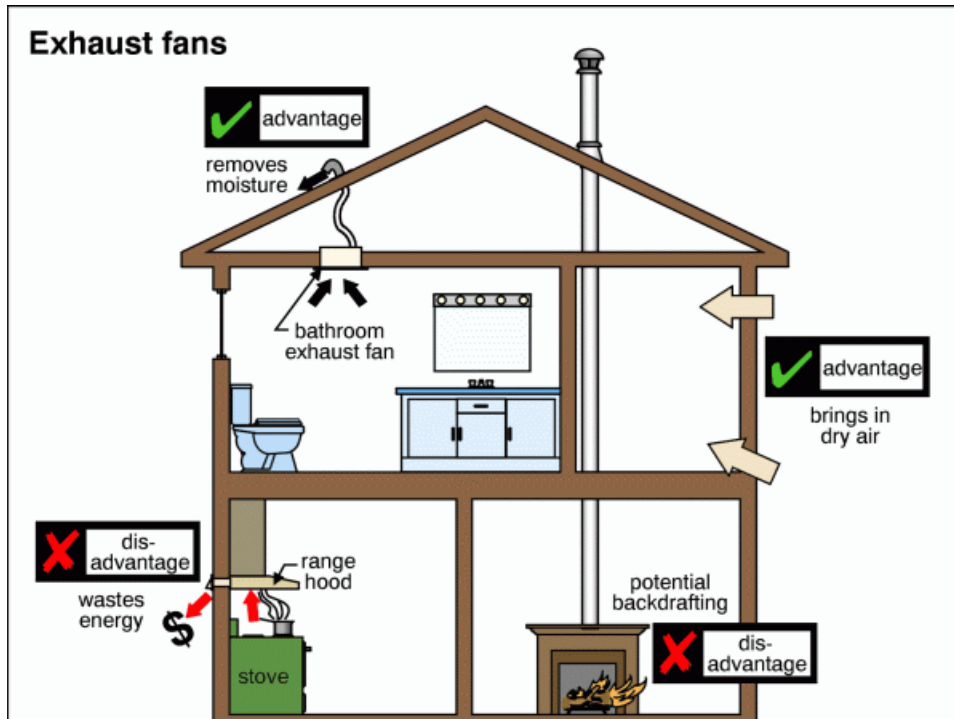

BASEMENT \ Leakage

Condition: • ***FOR FUTURE REFERENCE*** GENERAL ADVICE FOR ALL HOMES IF BASEMENT LEAKAGE IS EVER OBSERVED

Basement Leakage 4-step method. Almost every basement (and crawlspace) leaks under the right conditions. Based on a one-time visit, it is impossible to know how often or severe leaks may be. While we look for evidence of past leakage during our inspection, this is often not a good indicator of current conditions. Exterior conditions such as poorly performing gutters and downspouts, and ground sloping down toward the house often cause basement leakage problems. To summarize, wet basement issues can be addressed in 4 steps: 1. First, ensure gutters and downspouts carry roof run-off away from the home. (relatively low cost) 2. If problems persist, slope the ground (including walks, patios and driveways) to direct water away from the home. (Low cost if done by homeowner. Higher cost if done by contractor or if driveways, patios and expensive landscaping are disturbed.) 3. If the problem is not resolved and the foundation is poured concrete, seal any leaking cracks and form-tie holes from the inside. (A typical cost is \$500 to \$600 per crack or \$300 per hole.) 4. As a last resort, dampproof the exterior of the foundation, provide a drainage membrane and add/repair perimeter drainage tile. (High cost)

BASEMENT \ Wet basements - vulnerability

Condition: • Typical of many homes with stone, brick, or block foundations, some moisture can be expected from time to

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
LINKS	MORE INFO	APPENDIX	REFERENCE						

time and is not unusual. Exterior grading and water management improvements are generally effective at reducing basement moisture. A dehumidifier can also be used to keep humidity levels down.

Inspection Methods and Limitations

General: • Up until about 1985, Asbestos was used in a multitude of building materials including but not limited to: Insulation on hydronic piping, attic insulation, flooring and ceiling tiles, stucco / stipple ceilings, glue, insulation around heating ducts and registers, plaster and so on. Identification of asbestos is outside the scope of a home inspection. If you have concerns about asbestos, consult with a professional environmental company that specializes with asbestos lab testing. If you plan to remove/disturb any building material, testing for asbestos is recommended beforehand.

Inspection limited/prevented by: • Storage/furnishings • New finishes/paint • Storage in closets and cabinets / cupboards

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), security systems, central vacuum • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any

Cosmetics: • No comment offered on cosmetic finishes

Appliances: • Appliances are not inspected as part of a building inspection • Appliances are not moved during an inspection

Percent of foundation not visible: • 95 %

Basement leakage: • Storage in basement limited inspection • Basement leakage is common. Most basements will experience leakage at some point. We cannot predict future occurrence or extent of basement leakage

LINKS

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

Descriptions

General: • [Low concentrations of CO can go undetected and can contribute to ongoing, unidentified illnesses. At high concentrations, it can be deadly.](#) • [Serious structural problems in houses are not very common, but when they occur they are never cheap to fix. Some cant be fixed at all. This report wont turn you into a home inspector, but it will give you some of the common indicators.](#) • [There are so many home maintenance and repair items that are important; it can be confusing trying to establish which are the most critical.](#) • [\(Life Cycles and Costs\)](#) • [This report will deal with the simpler topic of home repair--basically replacing things that are worn out or fixing things that are broken.](#) • [Common Building Technical Terms Explained](#)

General: • [The Inspection Professionals Website](#)

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
LINKS	MORE INFO	APPENDIX	REFERENCE						

Descriptions

GOOD ADVICE FOR ALL HOMEOWNERS: • The following items apply to all homes and explain how to prevent and correct some common problems.

Roof Leaks: • Roofs may leak at any time. Leaks often appear at roof penetrations, flashings, changes in direction or changes in material. A roof leak should be addressed promptly to avoid damage to the structure, interior finishes and furnishings. A roof leak does not necessarily mean the roof has to be replaced.

Annual Roof Maintenance: • We recommend an annual inspection and tune-up to minimize the risk of leakage and to maximize the life of your roof.

Ice Dams on Roofs: • [Most roofs are susceptible to ice dams under the right weather conditions. This is where ice forms](#) at the lower edge of a sloped roof, causing melting water from above to back up under the shingles. We cannot predict which roofs will suffer the most damage under adverse weather.

Maintaining the Exterior of Your Home: • Regular maintenance includes painting and caulking of all exterior wood.

Insulation Amounts - Current Standards: • R-50

Reduce Air Leaks: • Insulation is not effective if air (and the heat that goes with it) can escape from the home. Caulking and weather-stripping help control air leakage, improving comfort while reducing energy consumption and costs. Air leakage control improvements are inexpensive and provide a high return on investment.

Bathtub and Shower Maintenance: • Caulking and grout in bathtubs and showers should be checked every six months and improved as necessary to prevent leakage and damage behind wall surfaces.

Basement/Crawlspace Leakage: • Almost every basement (and crawlspace) leaks under the right conditions. • [Click for](#) more information.

MORE GOOD ADVICE FOR ALL HOMES: • Here is some more information that applies to all homes. • Before 1985, asbestos usage was common and was used in many building materials. Often 'popcorn' or plaster used on ceilings during this area contained a small percentage of asbestos. It is recommended to have the material tested for asbestos prior to disturbing/removing. Tests generally cost \$125-\$150 per sample and 3 samples are required per room. If positive for asbestos, costs to remove drywall containing asbestos is around \$8-\$12 per sq ft plus cost of re-installing drywall. (plaster and lath removal costs higher) Removal of ceiling material is classified as Type 3.

MORE GOOD INFORMATION: • The following links give you access to documents that provide additional information on a range of topics.

Life Cycles and Costs: • [Ballpark estimates based on a typical three-bedroom home.](#)

Priority Items for Home Buyers: • [A list of things you should do when moving into your new home and a few regular](#) maintenance items.

Maintenance: • [Scheduled maintenance can avoid repairs and extend the life expectancy of many home components.](#) This document helps you look after your home.

When Things Go Wrong: • [Unpleasant surprises are unfortunately part of homeownership. This document helps to](#) explain why things happen and why your home inspector may not have predicted it.

Standards of Practice: • [This document sets out what a professional home inspection should include, and guides the](#) activities of our inspectors.

MORE INFO

915 Ossington Avenue, Toronto, ON February 18, 2022

Report No. 7026, v.2

www.inspectionpros.ca

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
LINKS	MORE INFO	APPENDIX	REFERENCE						

END OF REPORT

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

LINKS

MORE INFO

APPENDIX

REFERENCE

**This is a copy of our home inspection contract and outlines the terms,
limitations and conditions of the home inspection**

THIS CONTRACT LIMITS THE LIABILITY OF THE HOME INSPECTION COMPANY AND INSPECTOR.

PLEASE READ CAREFULLY BEFORE SIGNING.

The Inspection of this property is subject to the Limitations and Conditions set out in this Agreement. It is based on a visual examination of the readily accessible features of the building. The Inspection is performed in accordance with the Standards of Practice of the Ontario Association of Home Inspectors. A copy of these Standards is available at <http://www.oahi.com/webdocs/StandardsofPractice-OAHI-Rev.pdf>.

The Home Inspector's report is an opinion of the present condition of the property. The Inspection and report are not a guarantee, warranty or an insurance policy with regards to the property. A Home Inspector cannot predict future deficiencies, intermittent problems or future water leakage.

PLEASE READ THE FOLLOWING PARAGRAPH: Due to the unpredictable nature of basement water leakage, a home inspector cannot predict future basement leakage. Almost all basements will leak at some point so there is a very good chance that it will happen. Basement leakage can occur for any number of reasons - Rainfall, sewer backup, high water tables, lot grading, clogged weeping tiles, gutter and downspout performance, just to name a few. The home inspector and The Inspection Professionals accepts no responsibility or liability for future basement water problems.

The inspection report is for the exclusive use of the client named above. No use of the information by any other party is intended. See item 8 below.

LIMITATIONS AND CONDITIONS OF THE HOME INSPECTION

These Limitations and Conditions explain the scope of your Home Inspection. Please read them carefully before signing this Agreement.

The purpose of your Home Inspection is to evaluate the general condition of a property. This includes determining whether systems are still performing their intended functions.

There are limitations to the scope of this Inspection. It provides a general overview of the more obvious repairs that may be needed. It is not intended to be an exhaustive list. The ultimate decision of what to repair or replace is yours. One homeowner may decide that certain conditions require repair or replacement, while another will not.

1. The Home Inspection provides you with a basic overview of the condition of the property. Because your Home Inspector has only a limited amount of time to go through the property, the Inspection is not technically exhaustive. If you have concerns about any of the conditions noted, please consult the text that is referenced in the report.

Some conditions noted, such as foundation cracks or other signs of settling in a house, may either be cosmetic or may indicate a potential structural problem that is beyond the scope of the Home Inspection.

If you are concerned about any conditions noted in the report, we strongly recommend that you consult a qualified licensed contractor or engineering specialist. These professionals can provide a more detailed analysis of any conditions noted in the report at an additional cost.

2. A Home Inspection does not include identifying defects that are hidden behind walls, floors or ceilings. This includes wiring, structure, plumbing and insulation that is hidden or inaccessible.

Some intermittent conditions may not be obvious on a Home Inspection because they only happen under certain circumstances. As an example, your Home Inspector may not discover leaks that occur only during certain weather conditions or when a specific tap or appliance is being used in everyday life.

Home Inspectors will not find conditions that may only be visible when storage or furniture is moved. Inspectors do not remove wall coverings, including wallpaper, or lift flooring, including carpet to look underneath.

A Home Inspection is a sampling exercise with respect to house components that are numerous, such as bricks, windows and electrical receptacles. As a result, some conditions that are visible may go un-reported.

3. The Inspection does not include hazardous materials that may be in or behind the walls, floors or ceilings of the property, whether visible or not. This includes building materials that are now suspected of posing a risk to health such as phenol-formaldehyde and urea-formaldehyde based products, fiberglass insulation and vermiculite insulation. The Inspector does not identify asbestos roofing, siding, wall, ceiling or floor finishes, insulation or fire proofing. We do not look for lead or other toxic metals in such things as pipes, paint or window coverings.

The Inspection does not deal with environmental hazards such as the past use of insecticides, fungicides, herbicide's or pesticides. The Inspector does not look for, or comment on, the past use of chemical termite treatments in or around the property.

4. We are not responsible for and do not comment on the quality of air in a building. The Inspector does not try to determine if there are irritants, pollutants, contaminants, or toxic materials in or around the building. The Inspection does not include spores, fungus, mold or mildew including that which may be concealed behind walls or under floors, for example. You should note that whenever there is water damage, there is a possibility that visible or concealed mold or mildew may be present unseen behind a wall, floor or ceiling.

If anyone in the home suffers from allergies or heightened sensitivity to quality of air, we strongly recommend that you consult a qualified Environmental Consultant who can test for toxic materials, mold and allergens.

5. Your Home Inspector does not look for, and is not responsible for, fuel oil, septic or gasoline tanks that may be buried on the property. If fuel oil or other storage tanks remain on the property, you may be responsible for their removal and the safe disposal of any contaminated soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Consultant to determine whether this is a potential problem.

6. We will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired, replaced, or otherwise changed before we have had a reasonable period of time to investigate.

7. The Client understands and agrees to be bound by each and every provision of this contract. The Client has the authority to bind any other family members or other interested parties to this Contract.

8. REPORT IS FOR OUR CLIENT ONLY. The inspection report is for the exclusive use of the client named herein. The client may provide the report to prospective buyers, at their own discretion. Potential buyers are required to obtain their own Onsite Review with The Inspection Professionals if they intend to rely on this report. The Inspection Professionals will not be responsible for the use of or reliance upon this Report by any third party without an Onsite Review and transfer of report to client after they have agreed to our inspection agreement.

9. The liability of the Home Inspector (and the Home Inspection Company) arising out of this Inspection and Report, for any cause of action whatsoever, whether in contract or in negligence, is limited to a refund of the fees that you have been charged for this inspection

SUMMARY	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
LINKS	MORE INFO	APPENDIX	REFERENCE						

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS

