

Your Inspection Report

346 Indian Road Crescent
Toronto, ON M6P 2H1

PREPARED FOR:
GILLIAN RITCHIE

INSPECTION DATE:
Monday, August 24, 2026

PREPARED BY:
ADAM HANNAN



TIP

**THE
INSPECTION
PROFESSIONALS**

THE INSPECTION PROFESSIONALS, INC.
3120 Rutherford Rd.
Concord, ON L4K 0B2

416-725-5568
HST# 89249 4501 RT0001

www.inspectionpros.ca
adam@inspectionpros.ca



TIP

THE
INSPECTION
PROFESSIONALS

August 25, 2026

Dear Gillian Ritchie,

RE: Report No. 9748
346 Indian Road Crescent
Toronto, ON
M6P 2H1

Thank you for choosing The Inspection Professionals to perform your Property Inspection. You can navigate the report by clicking the tabs at the top of each page. The Reference tab includes a 500-page Reference Library.

The Inspection Professionals (TIP) is a multi-inspector, award-winning company founded by Adam Hannan. Since 2006, Adam has performed thousands of residential and commercial inspections and has become a respected expert in his field. Adam has a passion for education and has been an inspection instructor teaching at Community Colleges and Universities since 2009.

Adam is a Certified Master Inspector and member of the International Association of Certified Home Inspectors (CPI # NACHIO7020704)

"We inspect every home as if we were buying it for ourselves. We care about our clients and we strive to exceed expectations. We offer a professional unbiased opinion of the current performance of the home regardless of who we are working for."

-Adam

BUYERS -

An Onsite Review is an important component of the home inspection process. To more thoroughly familiarize yourself with the property and our findings, we recommend booking an Onsite Review by calling (416) 725-5568. Once the Onsite Review has been completed, the inspection report will be transferred to the buyer.

The fee for this service is \$295. A full phone report review is also available.

Sincerely,

ADAM HANNAN
on behalf of
THE INSPECTION PROFESSIONALS, INC.

THE INSPECTION PROFESSIONALS,
INC.
3120 Rutherford Rd.
Concord, ON L4K 0B2
416-725-5568
HST# 89249 4501 RT0001
www.inspectionpros.ca
adam@inspectionpros.ca

SUMMARY

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

HIGHLIGHTS:

This multi-unit detached home, with an original portion dating to approximately 1890 and additions, remodeling and upgrades completed over time, is in very good condition overall compared to homes of similar age and style.

No significant structural performance-related concerns were observed at the time of inspection.

The electrical system is separately metered for each of the three units, with individual disconnects and distribution panels provided for each unit. Each distribution panel is rated at 125 amps. All receptacles tested were grounded, and all visible wiring was copper.

The home is heated primarily by electric baseboard heaters, with mini-split heat pump systems also present for heating and cooling.

The domestic hot water heater is approximately 4 years old.

The individual units appear well maintained.

As is typical for homes of this age and with subsequent improvements, there is a mix of newer and older systems and components.

This summary outlines some of the potentially significant issues that may require short-term attention due to cost, safety, or performance concerns. The summary items below are brief references to findings detailed in the body of the report. This section is provided as a courtesy only and is not a substitute for reading the entire report. Please review the full report in detail.

SUMMARY:

COOLING

Upper-unit ductless heat pump system is functional and nearing the end of its typical lifespan.

SUMMARY

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

IMPORTANT NOTES:

NOTE: ALL ELECTRICAL ISSUES ARE CONSIDERED PRIORITY ITEMS.

NOTE: THE TERM 'MINOR' GENERALLY REFERS TO COSTS UNDER \$1000.

NOTE: FOR DIRECTIONAL PURPOSES, "FRONT" OF HOUSE IS REFERENCED AS FACING THE FRONT DOOR FROM THE OUTSIDE.

This inspection is not a technical audit. The focus of the home inspection is to identify visible significant defects or issues with major systems and components in accordance with the most recent CAHPI Standards of Practice. We recommend budgeting between 0.5% to 1% of the homes value annually for unforeseen repairs and maintenance.

Disclaimer / Note to prospective buyers: This inspection report was performed for our client(s) named on this report. No liability is assumed for third parties reviewing this report. An onsite review must be arranged if you are a buyer, including signature on our inspection agreement. By relying on this report without our onsite review, you agree to waive all rights.

ROOFING

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

Sloped roofing material:

- [Asphalt shingles](#)



1. Asphalt shingles

Approximate age: • Age not determined. Roof appears serviceable with no visible signs of advanced wear. Replacement not considered imminent based on current observed condition.

Typical life expectancy: • 15-20 years

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Roofing issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes.

RECOMMENDATIONS \ Overview

Condition: • Annual roof maintenance is recommended to identify and repair damage to roofing materials, flashings and caulking. Regular roof maintenance reduces the risk of leaks and resulting water damage and may help extend the service life of the roof.

Location: Exterior Roof

Task: Inspect annually

Time: Ongoing

SLOPED ROOFING \ Asphalt shingles

Condition: • [Missing, loose or torn](#)

Location: Front and rear roof

Task: Repair

Time: Less than 6 months

Cost: Minor

ROOFING

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE



2. Missing, loose or torn



3. Missing, loose or torn

Inspection Methods and Limitations

Inspection performed: • With binoculars from the ground • With a drone

EXTERIOR

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

Gutter & downspout material: • [Aluminum](#)

Gutter & downspout discharge: • [Above grade](#)

Lot slope: • [Away from building](#) • [Flat](#)

Wall surfaces and trim: • Stucco or EIFS (Exterior Insulation and Finishing System or Synthetic Stucco)

Wall surfaces - masonry: • [Brick](#)

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Exterior issues noted have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes, moisture intrusion, personal safety, shortened life expectancy of materials, and material deterioration

WALLS \ Soffits (underside of eaves) and fascia (front edge of eaves)


Condition: • [Loose or missing pieces](#)

Location: Exterior right side

Task: Repair

Time: As soon as practical

Cost: Minor

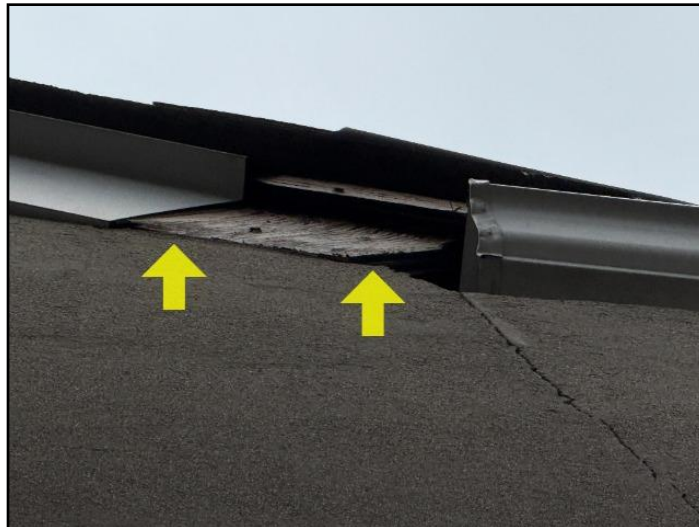

4. Loose or missing pieces

WALLS \ EIFS (Exterior Insulation and Finishing System) and Stucco

Condition: • [Cracked](#)

A vertical crack was noted at the right exterior wall near the addition. No significant displacement was observed.

Location: Right Side Exterior Wall

Task: Seal / Repair and monitor for movement or recurrence

Time: As soon as practical

EXTERIOR

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE



5.

EXTERIOR GLASS/WINDOWS \ Window wells

Condition: • [Less than 6 inches below window](#)

Location: Left Side Exterior

Task: Improve

Time: Less than 1 year



6. *Less than 6 inches below window*

PORCHES, DECKS, STAIRS, PATIOS AND BALCONIES \ Handrails and guards

Condition: • [Missing](#)

Location: Rear exterior deck steps

Task: Provide Handrail

Time: Less than 1 year

Cost: Minor

EXTERIOR

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Condition: • [Ineffective](#)

Wood lattice guard was loose/poorly secured.

Location: Front Exterior Porch

Task: Improve / Provide suitable guard

Time: As soon as practical

Cost: Minor



7. Ineffective

BASEMENT WALKOUTS \ General notes

Condition: • [Guard and handrail problems](#)

Guardrail was secured to loose/moving pavers, allowing movement of the guard when pushed.

Location: Front basement walkout

Task: Secure

Time: As soon as practical



8. Guard and handrail problems

EXTERIOR

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Condition: • Drain not visible

A floor drain was not visible at the basement walkout. The floor surface was covered with interlocking/plastic tiles, and it could not be determined whether a drain is present below. Confirm that a functional drain is provided.

Location: Front basement walkout

Task: Confirm / Provide if necessary

Time: As soon as practical

REGULAR MAINTENANCE \ Comments \ Additional

Condition: • The following are minor exterior deficiencies and upkeep items noted during the inspection. These should be addressed through routine maintenance to help reduce the risk of deterioration, moisture intrusion, or safety concerns:

- Localized peeling/deterioration at foundation coating - Various exterior - Repair/recoat as needed
- Paint deterioration at gable trim/fascia - Front exterior - Improve, regular maintenance
- Localized gaps/openings at wall surfaces where wiring enters wall - Right exterior - Seal/repair
- Localized mortar deterioration at front steps - Front exterior - Repoint/repair
- Vines/vegetation against exterior wall - Right exterior - Remove/cut back, regular maintenance
- Localized uneven/settled pavers creating a minor trip hazard - Front walkway - Level/repair as needed
- Localized low areas in grading adjacent to window wells - Left side exterior - Improve grading as needed

Location: Various Exterior

Task: Repair / Replace or Improve as noted

Time: Regular maintenance / Routine upkeep

Inspection Methods and Limitations

Upper floors inspected from: • Ground level

Not included as part of a building inspection: • Underground components (e.g., oil tanks, septic fields, underground drainage systems)

STRUCTURE

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

General: • No significant structural performance issues were observed in visible areas.

Configuration: • [Basement](#)

Foundation material: • Not visible

Floor construction: • [Joists](#)

Exterior wall construction: • Brick veneer at front • Not determined in all areas

Roof and ceiling framing: • Rafters

Observations and Recommendations

FOUNDATIONS \ General notes

Condition: • Typical minor cracks

Almost all houses with concrete foundations have minor settlement and/or shrinkage cracks. Monitor all cracks for movement and nuisance water leakage. Repair cracks only if necessary

Location: Various Exterior Wall

Task: Monitor for movement or leakage / Repair

Time: Ongoing / if necessary

Inspection Methods and Limitations

Inspection limited/prevented by: • Finishes, insulation, furnishings and storage conceal structural components.

Attic/roof space: • Inspected from access hatch

Percent of foundation not visible: • 95 %

Not included as part of a building inspection: • An opinion about the adequacy of structural components

Descriptions

General: • ALL ELECTRICAL CONDITIONS ARE CONSIDERED PRIORITY ITEMS

Service entrance cable and location: • [Overhead - cable type not determined](#)

Service size:

• [200 Amps \(240 Volts\)](#)

200-amp service to the home, divided among three separately metered units.

Main disconnect/service box type and location:


• [Fuses - basement](#)




9. Fuses

System grounding material and type: • [Not visible](#)

Distribution panel type and location: • Breaker panels

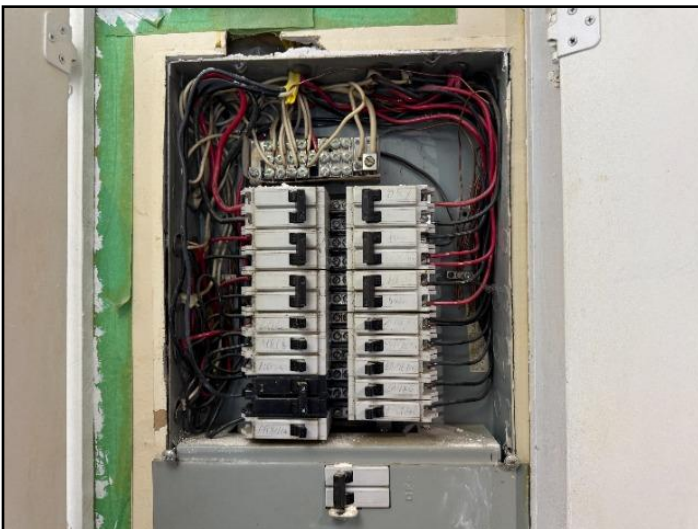

10. Breakers - Upper unit

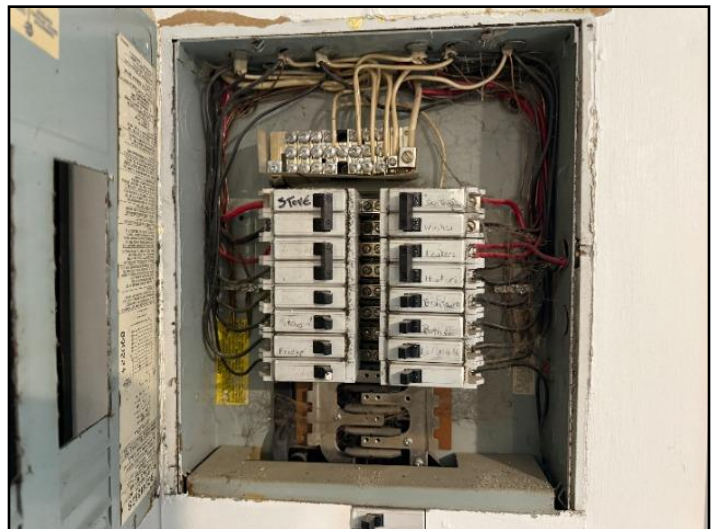

11. Breakers - Basement unit

ELECTRICAL

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING


INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

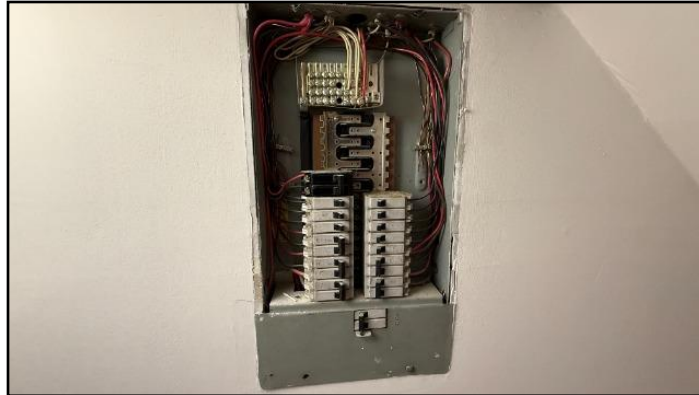

12. Breakers - Main floor unit

Distribution panel rating: • [125 Amps](#)

Distribution wire (conductor) material and type: • [Copper - non-metallic sheathed](#)

Type and number of outlets (receptacles): • [Grounded - typical](#)

Circuit interrupters: Ground Fault (GFCI) & Arc Fault (AFCI): • [GFCI - bathroom and exterior](#)

Smoke alarms (detectors): • [Present](#)

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • ALL ELECTRICAL recommendations are safety-related. POTENTIAL worst-case implications include fire, shock hazards, service access and operation. Treat them as high-priority items and assume the time frame is Immediate / As soon as possible unless otherwise noted.

SERVICE BOX, GROUNDING AND PANEL \ Distribution fuses/breakers


Condition: • [Double taps](#)

Location: Main floor panel

Task: Correct

Time: As Soon As Possible

Cost: Minor

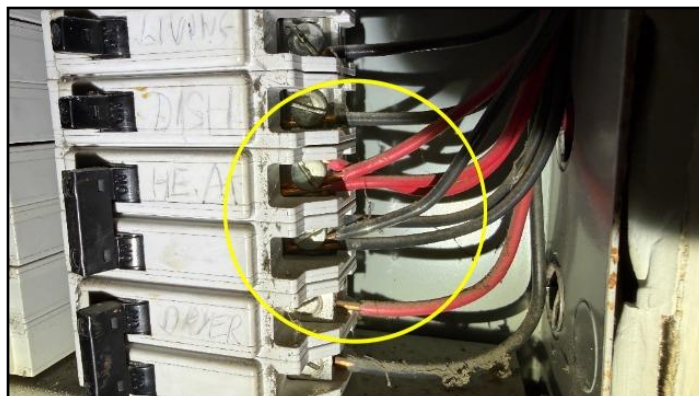

13. Double taps

DISTRIBUTION SYSTEM \ Outlets (receptacles) - number or location**Condition:** • [Above electric baseboard heaters](#)

One receptacle was observed above an electric baseboard heater. Additional locations may be concealed by furnishings.

Location: Upper unit bedroom**Task:** Remove / Relocate**Time:** Prior to use**Cost:** minor

14. Above electric baseboard heaters

DISTRIBUTION SYSTEM \ GFCI (Ground Fault Circuit Interrupter) protection not noted at**Condition:** • Within 6 ft. of the outer edge of a kitchen sink or laundry tub**Location:** Various kitchens**Task:** Upgrade to GFI outlets**Time:** As Soon As Practical**Cost:** Minor**DISTRIBUTION SYSTEM \ Smoke alarms (detectors)**

Condition: • Smoke and CO detectors should be updated / provided as needed. These devices are not tested during the inspection. Replace if age is unknown or over 10 years.

Inspection Methods and Limitations**System ground:** • Quality of ground not determined

HEATING

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

Heating system type: • Electric baseboard heaters • [Space heaters](#)

Fuel/energy source: • [Electricity](#)

Heat distribution: • [Baseboards](#)

Auxiliary heat: • [Electric heater](#)

Observations and Recommendations

RECOMMENDATIONS \ Overview

Condition: • No heating recommendations are offered as a result of this inspection.

Inspection Methods and Limitations

Safety devices: • Not tested as part of a building inspection

Heat loss calculations: • Not done as part of a building inspection

Heat exchanger: • Not visible

COOLING & HEAT PUMP

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

Heat pump type: • [Air source](#) • [Ductless \(Mini split\) system](#)

Cooling capacity: • 12,000 BTU/hr • 15,000 BTU/hr

Compressor approximate age: • Left-side exterior heat pump and upper interior unit: November 2011. Main-floor unit: September 2017. Right-side exterior heat pump: 2018. Ages confirmed with manufacturer.

Typical life expectancy: • 10 to 15 years

Observations and Recommendations

HEAT PUMP \ Life expectancy

Condition: • [Near end of life expectancy](#)

The Fujitsu ductless heat pump system serving the upper unit, including the exterior heat pump and indoor unit, was manufactured in November 2011 and is approximately 14 years old. Typical life expectancy is approximately 10-15 years. Continue using while functional and plan for replacement as needed.

Implication(s): Reduced comfort

Location: Left side exterior heat pump / Upper unit indoor unit

Task: Replace

Time: When necessary / Unpredictable

Cost: \$4,000 and up

Inspection Methods and Limitations

Heat gain/loss calculations: • Not done as part of a building inspection

Window unit: • Window A/C excluded from inspection

Not included as part of a building inspection: • Window cooling system

INSULATION AND VENTILATION

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

Attic/roof insulation material: • [Glass fiber](#)

Attic/roof insulation amount/value: • R-20 to R-32

Attic/roof air/vapor barrier: • [Plastic](#) • Spot Checked Only

Foundation wall insulation material: • Not visible

Foundation wall insulation amount/value: • Not visible

Observations and Recommendations

ATTIC/ROOF \ Insulation

Condition: • [Amount less than current standards](#)

Below current standards of R-60 (as of 2016).

Location: Throughout Attic

Task: Upgrade

Time: Discretionary

Cost: \$2000 and up

ATTIC/ROOF \ Hatch/Door

Condition: • [Not insulated and not weatherstripped](#)

Location: Attic

Task: Improve

Time: Less than 1 year

Cost: Minor

Inspection Methods and Limitations

Inspection limited/prevented by lack of access to: • Walls, which were spot checked only

Attic inspection performed: • From access hatch

Roof ventilation system performance: • Not evaluated

Air/vapor barrier system: • Continuity not verified

Descriptions

Service piping into building: • [Not visible](#)

Supply piping in building: • [Copper](#)

Main water shut off valve at the: • Inquire with homeseller

Water flow and pressure: • [Functional](#) • [Typical for neighborhood](#)

Water heater type: • [Induced draft](#)

Water heater fuel/energy source: • [Gas](#)

Water heater tank capacity: • 284 liters

Water heater approximate age: • 4 years

Water heater typical life expectancy: • 10 to 15 years

Waste and vent piping in building: • [Plastic](#)

Pumps: • [Sump pump](#)

Floor drain location: • Near water heater

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Plumbing issues have POTENTIAL worst-case implications of water damage to contents, finishes and/or structure, no hot or cold water, leakage, possible hidden damage, difficult to service, sewage entering building, health hazards.

WASTE PLUMBING \ Traps - installation

Condition: • Nonstandard shape or material

Location: Main floor bathroom basin

Task: Monitor for siphoning or clogging and improve if necessary

Cost: Minor



15. Nonstandard shape or material

FIXTURES AND FAUCETS \ Bathtub enclosure

Condition: • [Tile loose, broken or missing](#)

Tiles in a localized area below the window were loose/moving. Caulking at the area was deteriorated.

Location: Upper unit bathroom enclosure

Task: Secure/Repair and recaulk

Time: As soon as practical



16. Tiles loose

Inspection Methods and Limitations

Items excluded from a building inspection: • Water quality • Isolating/relief valves & main shut-off valve • Concealed plumbing • Tub/sink overflows • Water treatment equipment • Tub and basin overflows are not tested as part of a home inspection. Leakage at the overflows is a common problem.

INTERIOR

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

General: • The interior of the home is in good condition overall.

Major wall and ceiling finishes: • [Plaster/drywall](#)

Windows: • A representative number of windows were checked for basic operation • [Fixed](#) • [Single/double hung](#) • Casement • Fair condition overall. Most windows tested were functional

Glazing: • [Double](#)

Exterior doors - type/material: • Hinged

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • All Interior issues have POTENTIAL worst-case implications such as damage to contents, structure and/or finishes, and personal safety.

Condition: • Typical minor flaws were noted on floors, walls and ceilings. These cosmetic issues reflect normal wear and tear. This can include worn or cracked flooring and blemishes on walls/ceilings

RECOMMENDATIONS \ Overview

Condition: • During our inspection, we look for evidence of basement moisture intrusion. We did not observe standing water or evidence of active moisture intrusion in visible areas on this particular day.

CEILINGS \ General notes

Condition: • Water stains - Dry at time of inspection

Tested with moisture meter.

Location: Basement hall ceiling

Task: For Your Information



17. Water stains - Dry at time of inspection

WINDOWS \ Sashes

Condition: • [Won't stay open](#)

Location: Rear main floor

Task: Repair

Time: When practical



18. Won't stay open

REGULAR MAINTENANCE \ Comments \ Additional

Condition: • Ongoing care to maintain finishes, function, and overall interior condition:

• Exposed rigid insulation board - Front basement utility room ceiling - Confirm protection requirements / cover if required

Location: Various

Task: Repair/Replace/Improve

Time: Regular maintenance / Routine upkeep

Inspection Methods and Limitations

Inspection limited/prevented by: • Storage/furnishings • New finishes/paint • Storage in closets and cabinets / cupboards

Not included as part of a building inspection: • Carbon monoxide alarms (detectors), security systems, central vacuum • Cosmetic issues • Appliances • Perimeter drainage tile around foundation, if any

Cosmetics: • No comment offered on cosmetic finishes

Appliances: • Appliances are not inspected as part of a building inspection • Appliances are not moved during an inspection

Percent of foundation not visible: • 95 %

Basement leakage: • Storage in basement limited inspection • Basement leakage is common. Most basements will experience leakage at some point. We cannot predict future occurrence or extent of basement leakage • Monitor the basement for leaks in the Spring.

Descriptions

General: • This section includes general maintenance and precautionary recommendations that apply to most homes, and are provided for future reference.

Observations and Recommendations

RECOMMENDATIONS \ General

Condition: • ALL HOMES - WALLS - Flashings and caulking - Caulking around windows, doors, and wall penetrations should be inspected regularly and improved as needed to prevent moisture entry and air leakage.

Condition: • ALL HOMES - WALLS - Masonry (brick, stone) and concrete - Most masonry walls have small cracks due to shrinkage or minor settlement. These will not be individually noted in the report, unless leakage, building movement or similar problems are noted.

Condition: • ALL HOMES - EXTERIOR - During rainfall, walk the perimeter of the home to observe whether any areas allow water to drain toward the foundation. Improve grading in those areas as needed to promote proper drainage away from the structure

Condition: • ALL HOMES BUILT BEFORE 1985 - Asbestos was used in a multitude of building materials including but not limited to: Insulation on hydronic piping, attic insulation, flooring and ceiling tiles, stucco / stipple ceilings, glue, insulation around heating ducts and registers, plaster and so on. Identification of asbestos is outside the scope of a home inspection. If you have concerns about asbestos, consult with a professional environmental company that specializes with asbestos lab testing. If you plan to remove/disturb any building material, testing for asbestos is recommended beforehand.

Condition: • ALL HOMES - HEATING - Set up annual service plan which includes coverage for parts and labour.

Condition: • ALL HOMES - PLUMBING - Grout and Caulking should be checked regularly and maintained to ensure water tight seal in bathtub and shower areas

Condition: • ALL HOMES BUILT PRIOR TO 1975 - PLUMBING - A video scan of the waste plumbing is recommended on older homes to check for tree roots, blockages, damaged pipe, or collapse. Typical cost is roughly \$300 to \$400.

Condition: • ALL HOMES WITH SUMP PUMP - PLUMBING - Provide backup power source for sump pump, keep backup sump pump on hand. Also consider providing a high water level alarm to alert of sump pump failure.

Condition: • ALL HOMES WITH SKYLIGHTS - Skylights are vulnerable to water leakage and should be monitored ongoing especially after heavy rain.

MORE INFO

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

Descriptions

GOOD ADVICE FOR ALL HOMEOWNERS: • The following items apply to all homes and explain how to prevent and correct some common problems.

Roof Leaks: • Roofs may leak at any time. Leaks often appear at roof penetrations, flashings, changes in direction or changes in material. A roof leak should be addressed promptly to avoid damage to the structure, interior finishes and furnishings. A roof leak does not necessarily mean the roof has to be replaced.

Annual Roof Maintenance: • We recommend an annual inspection and tune-up to minimize the risk of leakage and to maximize the life of your roof.

Ice Dams on Roofs: • [Most roofs are susceptible to ice dams under the right weather conditions. This is where ice forms](#) at the lower edge of a sloped roof, causing melting water from above to back up under the shingles. We cannot predict which roofs will suffer the most damage under adverse weather.

Maintaining the Exterior of Your Home: • Regular maintenance includes painting and caulking of all exterior wood. • To manage water drainage around the exterior, ensure that grading (ground) is maintained with a positive slope away from the home and extend any downspouts away from walls and all building components. • ***FOR FUTURE REFERENCE*** GENERAL ADVICE FOR ALL HOMES IF BASEMENT LEAKAGE IS EVER OBSERVED Basement Leakage 4-step method. Almost every basement (and crawlspace) leaks under the right conditions. Based on a one-time visit, it is impossible to know how often or severe leaks may be. While we look for evidence of past leakage during our inspection, this is often not a good indicator of current conditions. Exterior conditions such as poorly performing gutters and downspouts, and ground sloping down toward the house often cause basement leakage problems. To summarize, wet basement issues can be addressed in 4 steps: 1. First, ensure gutters and downspouts carry roof run-off away from the home. (relatively low cost) 2. If problems persist, slope the ground (including walks, patios and driveways) to direct water away from the home. (Low cost if done by homeowner. Higher cost if done by contractor or if driveways, patios and expensive landscaping are disturbed.) 3. If the problem is not resolved and the foundation is poured concrete, seal any leaking cracks and form-tie holes from the inside. (A typical cost is \$500 to \$600 per crack or \$300 per hole.) 4. As a last resort, dampproof the exterior of the foundation, provide a drainage membrane and add/repair perimeter drainage tile. (High cost)

Insulation Amounts - Current Standards: • Attic current standards as of 2016 is R-60

Reduce Air Leaks: • Insulation is not effective if air (and the heat that goes with it) can escape from the home. Caulking and weather-stripping help control air leakage, improving comfort while reducing energy consumption and costs. Air leakage control improvements are inexpensive and provide a high return on investment.

Bathtub and Shower Maintenance: • Caulking and grout in bathtubs and showers should be checked every six months and improved as necessary to prevent leakage and damage behind wall surfaces.

Basement/Crawlspace Leakage: • Almost every basement (and crawlspace) leaks under the right conditions.

Standards of Practice: • [This document sets out what a professional home inspection should include, and guides the activities of our inspectors.](#)

This inspection was performed in accordance with the most recent CAHPI Standards of Practice. Click the blue link above to view the full document.

END OF REPORT

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

This is a copy of our Home Inspection contract and outlines the terms, limitations and conditions of the Home Inspection

THIS CONTRACT LIMITS THE LIABILITY OF THE HOME INSPECTION COMPANY AND INSPECTOR.

PLEASE READ CAREFULLY BEFORE SIGNING.

The Inspection of this property is subject to the Limitations and Conditions set out in this Agreement. It is based on a visual examination of the readily accessible features of the building. The Inspection is performed in accordance with the National Standards of Practice of the Canadian Association of Home & Property Inspectors (CAHPI). A copy of these Standards is available at <https://www.cahpi.ca/en/home-inspectors/inspector-standards>

The Home Inspector's report is an opinion of the present condition of the property. The Inspection and Report are not a guarantee, warranty or an insurance policy with regards to the property. A Home Inspector cannot predict future deficiencies, intermittent problems or future water leakage.

PLEASE READ THE FOLLOWING PARAGRAPH: Due to the unpredictable nature of basement water leakage, a home inspector cannot predict future basement leakage. Almost all basements will leak at some point so there is a very good chance that it will happen. Basement leakage can occur for any number of reasons - Rainfall, sewer backup, high water tables, lot grading, clogged weeping tiles, gutter and downspout performance, just to name a few. The home inspector and The Inspection Professionals accept no responsibility or liability for future basement water problems.

The inspection report is for the exclusive use of the client named above. No use of the information by any other party is intended. See item 9 below.

LIMITATIONS AND CONDITIONS OF THE HOME INSPECTION

These Limitations and Conditions explain the scope of your Home Inspection. Please read them carefully before signing this Agreement.

The purpose of your Home Inspection is to evaluate the general condition of a property. This includes determining whether systems are still performing their intended functions.

There are limitations to the scope of this Inspection. It provides a general overview of the more obvious repairs that may be needed. It is not intended to be an exhaustive list. The ultimate decision of what to repair or replace is yours. One homeowner may decide that certain conditions require repair or replacement, while another will not.

1. The Home Inspection provides you with a basic overview of the condition of the property. Because your Home Inspector has only a limited amount of time to go through the property, the Inspection is not technically exhaustive. Some conditions noted, such as foundation cracks or other signs of settling in a house, may either be cosmetic or may indicate a potential structural problem that is beyond the scope of the Home Inspection. If you are concerned about any conditions noted in the report, we strongly recommend that you consult a qualified licensed contractor, engineer, or other qualified specialist. These professionals can provide a more detailed analysis of any conditions noted in the report at an additional cost.

2. A Home Inspection does not include identifying defects that are hidden behind walls, floors or ceilings. This includes wiring, structure, plumbing and insulation that is hidden or inaccessible. Some intermittent conditions may not be obvious on a Home Inspection because they only happen under certain circumstances. As an example, your Home Inspector may not discover leaks that occur only during certain weather conditions or when a specific tap or appliance is being used in everyday life. Home Inspectors will not find conditions that may only be visible when storage or furniture is moved. Inspectors do not remove wall coverings, including wallpaper, or lift flooring, including carpet to look underneath.

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

A Home Inspection is a sampling exercise with respect to house components that are numerous, such as bricks, windows and electrical receptacles. As a result, some conditions that are visible may go un-reported.

3. The Inspection does not include hazardous materials that may be in or behind the walls, floors or ceilings of the property, whether visible or not. This includes building materials that are now suspected of posing a risk to health such as phenol-formaldehyde and urea-formaldehyde based products, fiberglass insulation and vermiculite insulation. The Inspector does not identify asbestos roofing, siding, wall, ceiling or floor finishes, insulation or fire proofing. We do not look for lead or other toxic metals in such things as pipes, paint or window coverings.

The Inspection does not deal with environmental hazards such as the past use of insecticides, fungicides, herbicides or pesticides. The Inspector does not look for, or comment on, the past use of chemical termite treatments in or around the property.

4. We are not responsible for and do not comment on the quality of air in a building. The Inspector does not try to determine if there are irritants, pollutants, contaminants, or toxic materials in or around the building. The Inspection does not include spores, fungus, mold or mildew including that which may be concealed behind walls or under floors, for example. You should note that whenever there is water damage, there is a possibility that visible or concealed mold or mildew may be present unseen behind a wall, floor or ceiling. If anyone in the home suffers from allergies or heightened sensitivity to quality of air, we strongly recommend that you consult a qualified Environmental Consultant who can test for toxic materials, mold and allergens.

5. Your Home Inspector does not look for, and is not responsible for, fuel oil, septic or gasoline tanks that may be buried on the property. If fuel oil or other storage tanks remain on the property, you may be responsible for their removal and the safe disposal of any contaminated soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Consultant to determine whether this is a potential problem.

6. We will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired, replaced, or otherwise changed before we have had a reasonable period of time to investigate.

7. The Client understands and agrees to be bound by each and every provision of this contract. The Client has the authority to bind any other family members or other interested parties to this Contract.

8. Thermal Imaging: Thermal imaging equipment may be used as an inspection aid but does not guarantee detection of all issues or moisture conditions.

9. REPORT IS FOR OUR CLIENT ONLY. The inspection report is for the exclusive use of the client(s) named herein. No use of the information by any other party is intended, except as set out in item 10 below.

10. PRE-LISTING INSPECTIONS: Where an inspection is performed for a seller or listing agent, repairs or alterations may be completed after the inspection. In such cases, the inspection report may be revised to reflect the condition of the property at the time of the final report publication. The client may provide the report to prospective buyers, at their own discretion. Prospective buyers are encouraged to obtain their own independent home inspection. If prospective buyers wish to rely on this report, they must arrange an Onsite Review with The Inspection Professionals and agree to our inspection agreement. Upon completion of this process, the report may be transferred to the buyer named in the inspection agreement, and that buyer shall become the client for purposes of reliance on the report. The Inspection Professionals will not be responsible for the use of or reliance upon this report by any third party who has not completed this process.

11. The liability of the Home Inspector (and the Home Inspection Company) arising out of this Inspection and Report, for any cause of action whatsoever, whether in contract or in negligence, is limited to a refund of the fees that you have been charged for this inspection.

REFERENCE LIBRARY

346 Indian Road Crescent, Toronto, ON August 24, 2026

Report No. 9748

www.inspectionpros.ca

SUMMARY

ROOFING

EXTERIOR

STRUCTURE

ELECTRICAL

HEATING

COOLING

INSULATION

PLUMBING

INTERIOR

MAINTENANC

MORE INFO

APPENDIX

REFERENCE

The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report.

Click on any link to read about that system.

» 01. ROOFING, FLASHINGS AND CHIMNEYS

» 02. EXTERIOR

» 03. STRUCTURE

» 04. ELECTRICAL

» 05. HEATING

» 06. COOLING/HEAT PUMPS

» 07. INSULATION

» 08. PLUMBING

» 09. INTERIOR

» 10. APPLIANCES

» 11. LIFE CYCLES AND COSTS

» 12. SUPPLEMENTARY

Asbestos

Radon

Urea Formaldehyde Foam Insulation (UFFI)

Lead

Carbon Monoxide

Mold

Household Pests

Termites and Carpenter Ants

» 13. HOME SET-UP AND MAINTENANCE

» 14. MORE ABOUT HOME INSPECTIONS