Your Inspection Report

15 Sunnylea Ave E Toronto, ON



PREPARED FOR: LEAH & MARK BOGUSKI

INSPECTION DATE: Wednesday, November 9, 2016

PREPARED BY: Adam Hannan





Carson, Dunlop & Associates Ltd. 120 Carlton Street, Suite 407 Toronto, ON M5A 4K2

416-964-9415

www.carsondunlop.com info@carsondunlop.com

Powered by Knowledge



November 9, 2016

Dear Leah & Mark Boguski,

RE: Report No. 56013 15 Sunnylea Ave E Toronto, ON

Thank you for choosing us to perform your home inspection. We hope the experience met your expectations.

There are a series of coloured tabs at the top of each page of the attached report that you can click for easy navigation. Each tab takes you to a section describing each major home system (Roofing, Exterior, Structure, etc.). Blue, underlined text indicates a hyperlink. Click on the hyperlink for more information on that subject or condition. There is further reference material at the end.

A home inspection identifies the current condition of the property but cannot predict the future. Our home warranty protects you against the high cost of repair and replacement to furnaces, air conditioners, water heaters and appliances for as long as you own your home. To learn more, click on the Appendix heading at the top of any page of your report.

To the potential buyer: We recommend an Onsite Review of the home to help you learn about the home and how to maintain it to protect your investment. You will receive a RecallChek report on the appliances and heating and cooling equipment. You will also become a member of the Carson Dunlop Homeowners Association. Among other benefits, you can contact us with questions any time, for as long as you own your home. Our telephone and e-mail consulting service is available at no cost to you.

Thanks again for choosing Carson Dunlop.

Sincerely,

Adam Hannan on behalf of Carson, Dunlop & Associates Ltd.

> Carson, Dunlop & Associates Ltd. 120 Carlton Street, Suite 407 Toronto, ON M5A 4K2 416-964-9415 www.carsondunlop.com info@carsondunlop.com



INVOICE

November 9, 2016

Client: Leah & Mark Boguski

Report No. 56013 For inspection at: 15 Sunnylea Ave E Toronto, ON

on: Wednesday, November 9, 2016

Sellers Home Inspection - Professional Inspector		\$520.00
Coupon		(\$25.00)
	Subtotal HST #108348343 RT0001	\$495.00 \$64.35
	Total	\$559.35

PAID IN FULL - THANK YOU!

Carson, Dunlop & Associates Ltd. 120 Carlton Street, Suite 407 Toronto, ON M5A 4K2 416-964-9415 www.carsondunlop.com info@carsondunlop.com

15 Sunnyl	ea Ave E, To	oronto, ON	November 9	9, 2016				www.carso	ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								

INTRODUCTION

This page is typically reserved for significant expenses that will likely occur in the short term. None were found.

The report does include important information, including some recommendations for improvements. This page must not be considered as the complete report. Please read the entire report and the appropriate text included in the provided hyperlinks.

The goal of a home inspection is to identify significant issues that would affect the average person's decision to buy a home. While looking for big issues we typically identify some minor defects along the way. We include these in the report as a courtesy, but please understand a home inspection is not a Technical Audit and does not include compiling a comprehensive list of minor issues. (That service is available at additional cost.)

FOR THE BUYER

This inspection report is very helpful, but it's not enough to make a decision about buying a home. A complete home inspection includes both an onsite review of the property with the home inspector and the inspection report. To book your Onsite Review, call us at 800-268-7070. Without an Onsite Review, our obligation and liability is limited to the seller.

When you move into the home you will typically identify a number of minor issues not identified in the report. That is to be expected and we suggest you allow roughly 1% of the value of the home annually for this type of maintenance and repair.

CONCLUSION

Houses are designed to last a very long time, but many of the components are consumable. Roofs, heating systems, air conditioning systems and water heaters, for example, wear out and are replaced from time to time. A home with older systems does not mean a poor quality house.

Many elements like kitchens, bathrooms, flooring, siding and windows are most often changed for lifestyle and decorating reasons. These discretionary home improvements are typically planned projects.

Un-planned repairs or replacements are never welcome, but are part of the 'joy of home ownership'. We encourage you to set up maintenance programs to protect your investment, reduce costs, improve comfort and efficiency, and extend life expectancy.

A Word About Water

Uncontrolled water is the enemy of homes. It not only damages the replaceable components, it also attacks the permanent elements of a home including wood and steel structural members, siding, trim, windows, doors, walls, floors and ceilings. Water also promotes mould growth.

Water sources include rain, snow, surface water, ground water; leaks from plumbing and heating systems and condensation. Again, preventative maintenance is the key to protecting your investment and avoiding water damage.

Report No. 56013

OVERVIEW

www.carsondunlop.com

15 Sunnylea Ave E, Toronto, ON November 9, 2016

OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								

This includes keeping gutters and downspouts clear and leak free, and discharging water well away from the building. Lot grading should slope slightly down away from the home to direct surface water away from the home.

Annual maintenance programs on roofs, gutters, heating and cooling systems help minimize water damage.

ASBESTOS, MOULD AND OTHER ENVIRONMENTAL ISSUES

Environmental issues are outside the scope of a home inspection. Inspectors do not identify or evaluate issues such as asbestos, mould and indoor air quality. Many building materials contain asbestos, and moisture problems may result in visible or concealed mould. An Environmental Consultant can assist with these types of issues. If you need help, call us at 416-964-9415. More information is available in the Appendix of the report

END OF OVERVIEW

NOTE: BALLPARK COSTS AND TIME FRAMES

Any ballpark costs and time estimates provided are a courtesy and should not be relied on for budgeting or decision-making. Quotes from specialists should be obtained. The word 'Minor' describes any cost up to roughly \$500.

ROOFING

Report No. 56013

15 Sunnylea Ave E, Toronto, ON November 9, 2016

www.carsondunlop.com

OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR	,				,					
	OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR

APPENDIX REFERENCE

Descriptions

General: • The roof covering is newer and in good condition.

Sloped roofing material:
• <u>Asphalt shingles</u>

Approximate age: • The roof covering appears to be at the beginning of its normal life expectancy.


Observations and Recommendations

<u>General</u>

• Asphalt shingle roof coverings wear out and are replaced every 15 years or more, depending on a number of variables. An annual roof tune-up by a qualified roofer is strongly recommended.

VULNERABLE AREAS \ Observations

Condition: • <u>Skylight(s)</u> - <u>vulnerable area for leaks</u> Task: Monitor Time: Ongoing

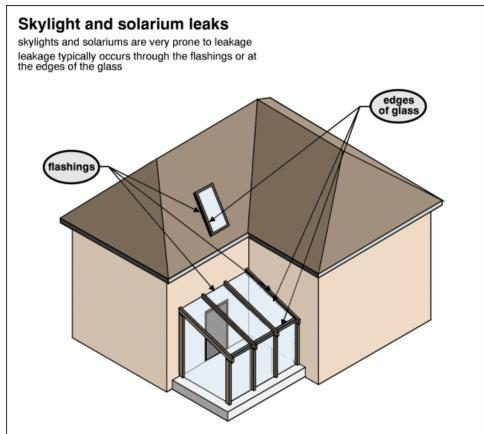

ROOFING

Report No. 56013

www.carsondunlop.com

15 Sunnylea Ave E, Toronto, ON November 9, 2016

016

STRUCTURE ELECTRICAL HEATING CO

INTERIOR

APPENDIX REFERENCE

ROOFING

Inspection Methods and Limitations

Roof inspection method: • Binoculars from the ground level • Through a window/skylight - limited view

Roof inspection limited/prevented by: • Eaves Protection - presence, continuity and effectiveness cannot be determined during a professional Home Inspection.

Roof inspection limited/prevented by: • Height

EXTERIOR

Report No. 56013

15 Sunnylea Ave E, Toronto, ON November 9, 2016

www.carsondunlop.com EXTERIOR STRUCTURE ELECTRICAL INSULATION PLUMBING REFERENCE

Descriptions

APPENDIX

General: • The exterior has been well maintained and is in good condition.

Gutter and Downspout Material(s): • Aluminum

Gutters and Downspouts: • Discharge above grade

Wall Surfaces: • Brick • Stucco/EIFS [Exterior Insulation and Finish System]

Observations and Recommendations

General

• Provide Annual Stucco 'Tune-Up'.

DOWNSPOUTS \ Observations

Condition: • Damage Location: Exterior Task: Repair / Replace Time: Regular maintenance Cost: Minor




Dented

Condition: • Discharge too close to Foundation (should discharge at least 2 m / 6 ft away); provide Downspout Extension Location: Various Exterior Task: Improve Time: Less than 1 year

Cost: Minor


Powered by Knowledge

EXTER 15 Sunnyl	-	Toronto, ON	November §	9, 2016					No. 56013 ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENC	E							
		Downspor	ut extensio		rt	framing			

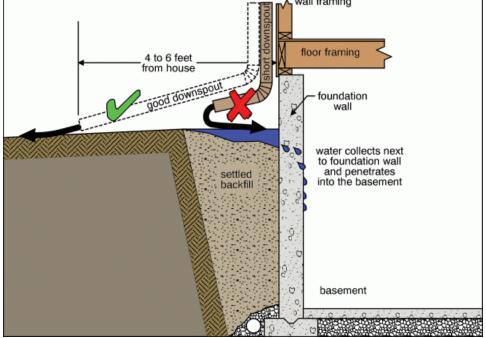

LOT GRADING \ Observations

Condition: • Window Well - missing 6 to 8 inches clearance below window Location: Rear Exterior Task: Improve Time: Less than 1 year Cost: Minor

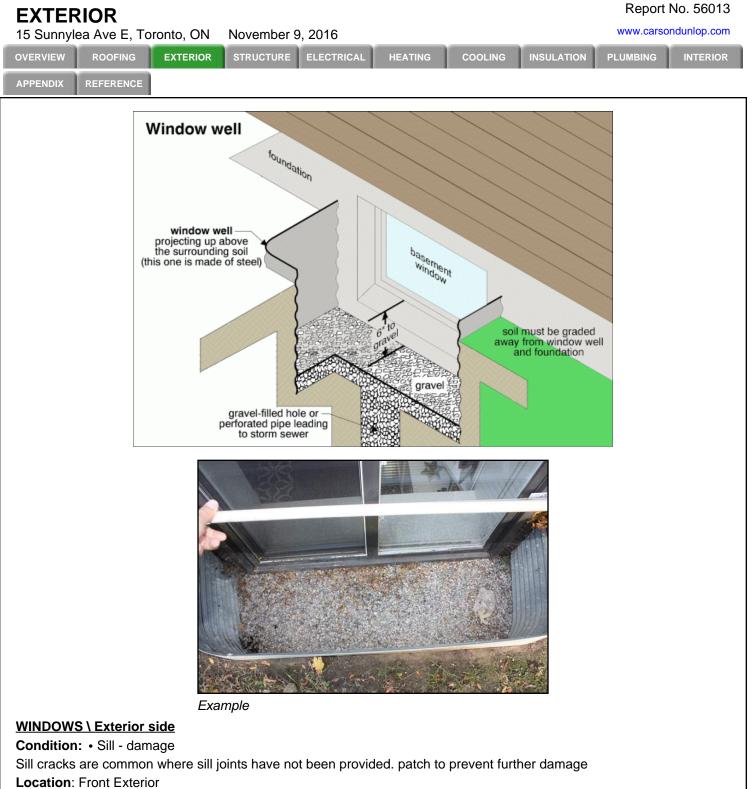

Task: Patch/Repair

Time: Less than 2 years / Regular maintenance

Cost: Regular maintenance item

EXTE	RIOR							Report N	No. 56013
	ea Ave E, To	ronto, ON	November 9	9, 2016				www.carsor	ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								
		1							
					1	Contraction (-		
		(HORIZO)			1				
				The second second	1 and a state of the				
			- 302	TAN/AR	S Martin	Spanne -			
		PX	Sta X	No the	K	ALL TAK			
				A CAR			16 Y		
		and the		NA ST		CALL AND			

Sill - damage

WALL SURFACES \ Observations

Condition: • EIFS (Synthetic stucco) needs good maintenance to prevent water entry. Vulnerable areas include doors, windows and wall penetrations.

Task: Monitor Time: Ongoing

Condition: • Utility entrances

Location: Exterior Wall Task: Provide Caulking / Sealant Time: Less than 1 year Cost: Minor



Utility entrances

Condition: • <u>Vent not well sealed</u> Location: Exterior Wall Task: Improve Time: Regular maintenance Cost: Regular maintenance item

EXTER	RIOR							Report I	No. 56013
	ea Ave E, To	ronto, ON	November 9	9, 2016				www.carsor	ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								
			5						



Vent not well sealed

EXTERIOR STRUCTURES \ Stairs

Condition: • Cracks

Minor hairline cracks noted. This is common with concrete steps. Monitor and Improve as necessary.

Location: Rear Exterior

Task: Monitor / Repair

Time: As necessary



Minor Cracks


minor cracks

GARAGE \ Observations

Condition: • Glass man-door noted - Less than ideal as a garage man-door.

Condition: • Man-door Self-closer - ineffective

Does not close fully - needs adjustment. Also, self closer should not be type that can remain open. Location: Garage Task: Correct Time: As soon as possible

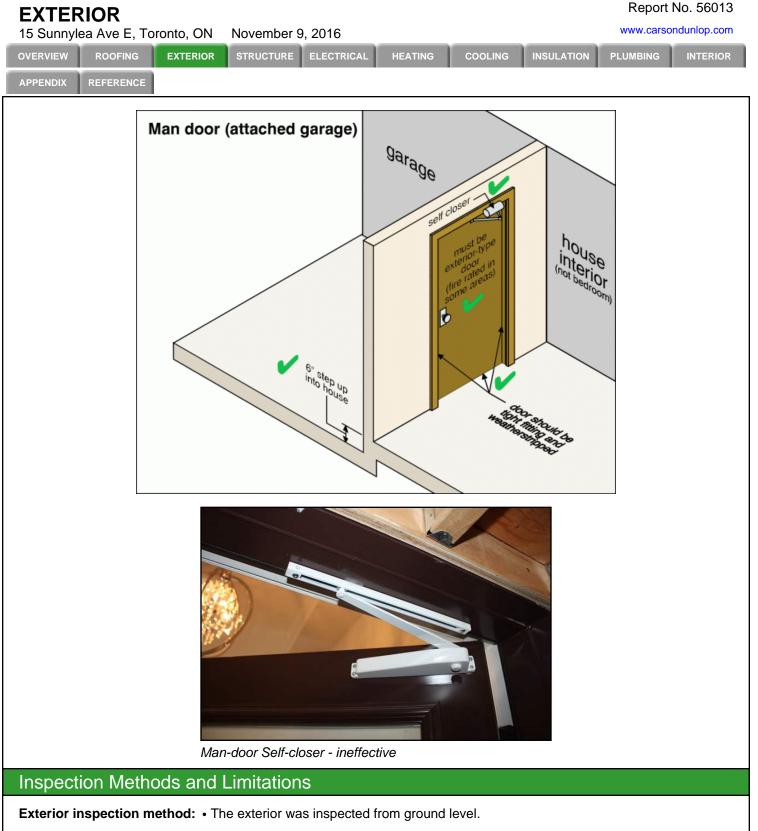

Limitations: • Fences, outbuildings (other than garages) and landscape features are not included as part of a home inspection. • Irrigation System - not evaluated as part of the Home Inspection

STRUCTURE

Report No. 56013

www.carsondunlop.com

15 Sunnylea Ave E, Toronto, ON November 9, 2016

STRUCTURE ELECTRICAL

HEATING COOLING

INSULATION PLUMBING

INTERIOR

APPENDIX	REFERENCE	
AFFENDIA	REFERENCE	

ROOFING

Descriptions

General: • The structure shows no sign of movement or distress.

Foundations: • Concrete / Masonry Block

Configuration:
• <u>Basement</u>

Floor Construction: • Joists - wood

Exterior Wall Construction: • Masonry • Wood Frame

Roof and Ceiling Framing:
• <u>Not visible in some areas</u> • <u>Trusses</u>

Observations and Recommendations

FOUNDATIONS \ Observations

Condition: • Underpinning noted.

Condition: • Most foundation walls have small cracks due to minor shrinkage, settlement or shifting. These will not be individually noted, unless leakage or building movement is noted.

Inspection Methods and Limitations

Structure inspection method: • Attic inspected from access hatch

Limitations: • Finishes, insulation, furnishings and storage conceal structural components, preventing/restricting inspection. • The footings supporting the house are typically not visible and cannot be inspected. Only a small part of the foundation can be seen and inspected from outside the home. Finished or concealed portions of the interior of the foundation cannot be inspected.

ELECTRICAL

Report No. 56013

15 Sunnylea Ave E, Toronto, ON November 9, 2016 www.carsondunlop.com										
STRUCTURE ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR					
<u>rhead - wiring material not</u>	<u>determined</u>									
<u>/olts)</u>										
System Grounding: • Water pipe - copper										
Distribution Panel Type and Location: • Breakers - Basement										
Distribution Wire: • Copper - non-metallic sheathed										
Outlet Type & Number: • Grounded - typical number										
Ground Fault Circuit Interrupters: • Powder Room(s)										
Ground Fault Circuit Interrupters: • Exterior • Kitchen(s)										
Arc Fault Circuit Interrupters: • Panel										
	STRUCTURE ELECTRICAL rhead - wiring material not /olts) be - copper bcation: • Breakers - Base bn-metallic sheathed aded - typical number ers: • Powder Room(s) ers: • Exterior • Kitchen(s)	R STRUCTURE ELECTRICAL HEATING rhead - wiring material not determined ////////////////////////////////////	R STRUCTURE ELECTRICAL HEATING COOLING rhead - wiring material not determined //olts) //olts) //olts) be - copper //ocation: • Breakers - Basement //on-metallic sheathed on-metallic sheathed //oded - typical number //ors: • Powder Room(s) ers: • Exterior • Kitchen(s) //ots) //ots)	R STRUCTURE ELECTRICAL HEATING COOLING INSULATION Inhead - wiring material not determined Volts) we - copper vocation: • Breakers - Basement vocation: • Breakers - Basement von-metallic sheathed voded - typical number ers: • Powder Room(s) ers: • Exterior • Kitchen(s)	R STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING rhead - wiring material not determined //olts) //olts) //olts) //olts) ree - copper //ocation: • Breakers - Basement //on-metallic sheathed //olts) on-metallic sheathed //oded - typical number //ors: • Powder Room(s) //ors: • Exterior • Kitchen(s)					


Observations and Recommendations

General

• All electrical recommendations are safety issues. Treat them as high priority items, and consider the Time frame as Immediate, unless otherwise noted.


SYSTEM GROUNDING \ Observations

Condition: • Bonding (for Gas Piping) - not visible Bonding not found - If not present, have electrician install bonding wire Location: Basement

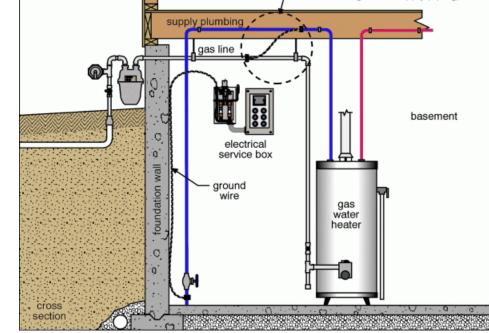

MAIN PANEL \ Breakers and Fuses

Condition: • Link - missing on multiwire circuit Location: Basement Panel Task: Correct Time: Immediate Cost: Minor

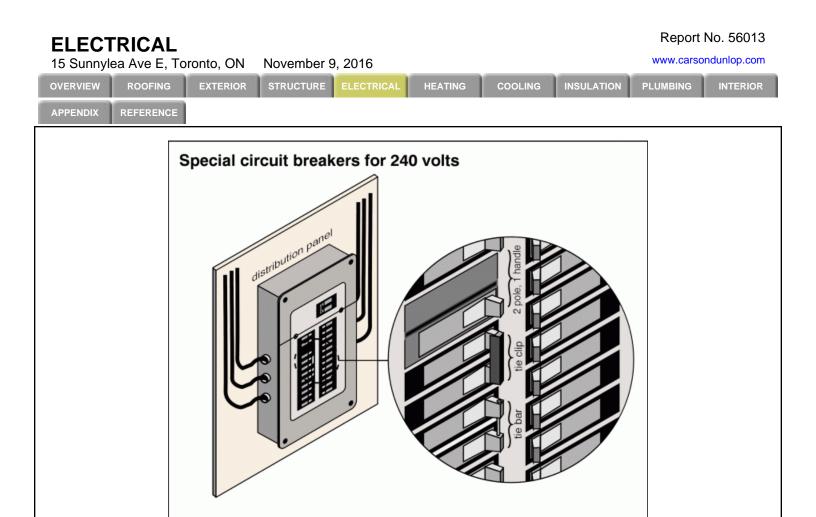

OUTLETS \ Observations

Condition: • Location poor

Currently inoperative. Might be rough in wiring for whirlpool. Do not provide power and use as outlet. Too close to bathtub.

Location: Master Bathroom

Task: Cap - Do Not Use



Location poor

ELECTRICAL

ROOFING

www.carsondunlop.com

15 Sunnylea Ave E, Toronto, ON November 9, 2016

STRUCTURE

	01	o						
--	----	---	--	--	--	--	--	--

COOLING

NSULATION PLUMBING

INTERIOR

APPENDIX REFERENCE

Inspection Methods and Limitations

Limitations: • Main disconnect cover not removed - unsafe to do so. • Concealed electrical components are not inspected. • The continuity and quality of the system ground are not verified as part of a home inspection. • The following low voltage systems are not included in a home inspection: intercom, alarm/security, doorbells, low voltage light control, central vacuum, telephone, television, Internet, and Smart Home wiring systems. • A professional home inspection includes the inspection of a representative sample of wiring, lights, receptacles, etc.

HEATING

Report No. 56013

15 Sunnylea Ave E, Toronto, ON	November 9, 2016			www.carsondunlop.com					
OVERVIEW ROOFING EXTERIOF	STRUCTURE ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR			
APPENDIX REFERENCE									
Descriptions									
General: • The furnace is a high	quality system.								
Main Heating System - Type: • <u>Furnace</u>									
Efficiency: • High efficiency									
Main Heating System - Fuel/Energy Source: • Natural gas									
Approximate Input Capacity: • <u>90,000 BTU/hr</u>									
Approximate Age: • <u>1 year</u>									

Typical Life Expectancy: • Furnace (high efficiency) - 15 to 20 years

Main Fuel Shut-off Location: • Gas Meter

Observations and Recommendations

<u>General</u>

• No Heating recommendations are offered as a result of this inspection.

• Furnaces have life expectancies that range from 10 to 25 years depending on the type, heating load and maintenance. An annual maintenance contract is strongly recommended.

Inspection Methods and Limitations

Limitations: • Heat loss calculations are not performed as part of a home inspection. • Safety devices are not tested as part of a home inspection. • The heat exchanger is substantially concealed and could not be inspected.

Environmental issues outside the scope of a home inspection: • Finding and identifying environmental issues such as asbestos is outside the scope of a home inspection. Asbestos may be present in many building products and materials. An Environmental Consultant can assist if this is a concern. This Specialty Service can be booked through Carson Dunlop at 1-800-268-7070.

COOLING

Report No. 56013

15 Sunnylea Ave E, Toronto, ON November 9, 2016

,		, -		,					
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								
Descrip	otions								
Air Condi	tioning Type	e: • Central a	air conditioni	ng - air coole	d				

Cooling Capacity : • <u>36,000 BTU/hr</u>

Approximate Age (Compressor): • <u>1 year</u>

Typical Life Expectancy: • 10 to 15 years

Observations and Recommendations

<u>General</u>

• No Cooling recommendations are offered as a result of this inspection.

• Air conditioning systems are complex with life expectancies of 10 to 15 years, if well maintained and serviced regularly. An annual maintenance contract is strongly recommended.

REGULAR MAINTENANCE \ Good advice for all homeowners

Condition: • An annual maintenance agreement that covers parts and labour is recommended.

Duct systems should be balanced during regular servicing. Systems with heating and air conditioning require different balance setups for summer and winter.

Inspection Methods and Limitations

Limitations: • Heat gain and heat loss calculations are not performed as part of a home inspection. • Low outdoor temperatures prevented testing in the cooling mode. • Air conditioning systems are not tested until they have been started up for the season.

Report No. 56013



Descriptions

Reference information on insulation levels: • Adding insulation is an improvement rather than a repair.

Attic Insulation - value & material:

• R-50





R-50

R-50

Fiberglass

Attic air/vapour barrier: • Plastic • Spot checked only

Roof Ventilation: • Roof vents • Soffit vents

Masonry Wall Insulation - value & material: • Amount not determined • Fiberglass

Wood Frame Wall Insulation - value & material: • Amount not determined

Basement Wall Insulation - value & material: • Amount not determined • Material not determined

Basement wall air/vapour barrier: • Plastic

Observations and Recommendations

General

• No Insulation recommendations are offered as a result of this inspection.

Inspection Methods and Limitations

Insulation inspection method: • See STRUCTURE: Inspection Methods and Limitations • Attic inspected from access hatch

Limitations: • Concealed wall insulation is not inspected. • The continuity of air/vapour barriers and the performance of roof and attic ventilation are not verified as part of a home inspection.

Environmental issues outside the scope of a home inspection: • Finding and identifying environmental issues such as asbestos is outside the scope of a home inspection. Asbestos may be present in many building products and materials. An Environmental Consultant can assist if this is a concern. This Specialty Service can be booked through Carson Dunlop at 1-800-268-7070.

PLUMBING

Report No. 56013

15 Sunnylea Ave E, Toronto, ON November 9, 2016	www.carsor	ndunlop.com
OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	PLUMBING	INTERIOR
APPENDIX REFERENCE		
Descriptions		
Water Piping to the Building: • Copper		
Supply Piping in the Building: • PEX (cross-linked polyethylene)		
Main Shut-off Valve Location: • Furnace area		
Water Heater Type and Energy Source: • Tankless / Instantaneous • Natural Gas		
Water Heater Tank Capacity: • Tankless water heater - no storage tank		
Water Heater Approximate Age: • 1 year		
Typical Life Expectancy: • 5 to 10 years		
Waste Piping Material: • Plastic		
Floor Drain Location: • Furnace area		
Pump:		
Solid waste (ejector) pump		
Bent-		

Solid waste (ejector) pump

• <u>Sump pump</u>

Abandoned Sump pit noted in cold room



Sump pump



Abandoned Sump

Powered by Knowledge

PLUMBING

www.carsondunlop.com

PLUMBING

15 Sunnylea Ave E, Toronto, ON November 9, 2016

STRUCTURE

ELECTRICAL	HEATING	COOLING	INSULA
	TILATING	COOLING	INCOLA

INSULATION

INTERIC

APPENDIX	REFERENCE
	I LI

Observations and Recommendations

<u>General</u>

• Most plumbing fixtures may be expected to last 15 years or more, although faucets are often replaced every 10 years. Domestic water heaters typically last 8 to 15 years, depending on several variables including type, usage levels and water quality.

WASTE PIPING \ Observations

ROOFING

Condition: • A video inspection of the waste plumbing is recommended to determine whether there are tree roots, other obstructions, or damaged pipe. This is common on older properties, especially when mature trees are nearby. This is a great precautionary measure and can help prevent a sewage backup, although many homeowners wait until there are problems with the drains. This Specialty Service can be booked through Carson Dunlop at 1-800-268-7070.

Inspection Methods and Limitations

Limitations: • Concealed plumbing is not inspected. This includes supply and waste piping under floors and under the yard. • Isolating valves, relief valves and main shut-off valves are not tested as part of a home inspection. • Tub and basin overflows are not tested as part of a home inspection. Leakage at the overflows is a common problem.

Report No. 56013

15 Sunnylea Ave E, Toronto, ON			November 9, 2016					www.carsondunlop.com		
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	
APPENDIX	REFERENCE									
Descrip	Descriptions									
General:	 Interior finis 	shes are in g	good repair ov	verall.						
General:	General: • Interior finishes are high quality for the most part.									
Windows	Windows: • Casement • Fixed • Sliders									
Exterior D	Exterior Doors: • Conventional - hinged									

Fireplaces and Stoves: • Fireplace - gas - factory built

Observations and Recommendations

General

INITERIOR

• Typical minor flaws were noted on floors, walls and ceilings. These cosmetic issues reflect normal wear and tear.

FIREPLACE / STOVE \ Observations

Condition: • A specialist should be engaged to inspect the gas fireplace prior to using the appliance. There are many manufacturers and many models of these units, with many different installation rules. We also recommend the gas fireplace be covered under a maintenance contract that includes regular service. Gas Fireplace was not tested onsite. Provide batteries in the remote control and test.

BASEMENT LEAKAGE \ Potential

Condition: • We cannot predict the frequency or severity of basement leakage.

WHAT TO DO IF YOUR BASEMENT OR CRAWLSPACE LEAKS \ Observations

Condition: • Almost every basement (and crawlspace) leaks under the right conditions. Based on a one-time visit, it's impossible to know how often or severe leaks may be. While we look for evidence of past leakage during our inspection, this is often not a good indicator of current conditions. Exterior conditions such as poorly performing gutters and downspouts, and ground sloping down toward the house often cause basement leakage problems. Please read Section 10.0 in the Interior section of the Home Reference Book before taking any action.

To summarize, wet basement issues can be addressed in 4 steps:

1. First, ensure gutters and downspouts carry roof run-off away from the home. (relatively low cost)

2. If problems persist, slope the ground (including walks, patios and driveways) to direct water away from the home. (Low cost if done by homeowner. Higher cost if done by contractor or if driveways, patios and expensive landscaping are disturbed.)

3. If the problem is not resolved and the foundation is poured concrete, seal any leaking cracks and form-tie holes from the inside. (A typical cost is \$300 to \$600 per crack or hole.)

4. As a last resort, dampproof the exterior of the foundation, provide a drainage membrane and add/repair perimeter drainage tile. (High cost)

INTERIOR

15 Sunnylea Ave E, Toronto, ON November 9, 2016

IOR

www.carsondunlop.com

OVERVIEV	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERI
APPENDI)	REFERENCE	1							

Inspection Methods and Limitations

Limitations: • Security systems, intercoms, central vacuum systems, chimney flues and elevators are not included as part of a home inspection. Smoke detectors and carbon monoxide detectors are not tested as part of a home inspection. • Limited access to cabinets and closets • Perimeter drainage tile around foundations is not visible and is not included as part of a home inspection. • Basement leakage frequency or severity cannot be predicted during a home inspection • No comment is made on cosmetic finishes during a home inspection.

Limitations: • Absence of historical clues due to new finishes/paint • Basement finishes restricted the inspection • Storage/furnishings in some areas limited inspection

% of interior foundation wall not visible: • 95

Environmental issues outside the scope of a home inspection: • Finding and identifying environmental issues such as asbestos is outside the scope of a home inspection. Asbestos may be present in many building products and materials. An Environmental Consultant can assist if this is a concern. This Specialty Service can be booked through Carson Dunlop at 1-800-268-7070.

END OF REPORT

APPENDIX							•	No. 56013	
15 Sunnyl	ea Ave E, To	oronto, ON	November 9	9, 2016				www.carso	ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								

IMPORTANT ADVICE FOR LOOKING AFTER YOUR HOME

Home maintenance is an important responsibility. It protects your investment, extends life expectancy and helps avoid significant expenses. This document is an integral part of the report, and will help you avoid many common problems and reduce costs.

Priority Maintenance and Home Set-Up

The **Home Set-Up and Maintenance** chapter in the Home Reference Book provides important information regarding things that are done once when moving in, as well as regular maintenance activities. Please be sure to follow these maintenance guidelines. The Home Reference Book is included under the **REFERENCE** tab in this report.

Basement/Crawlspace Leakage

Basement water leakage is the most common problem with homes. Almost every basement and crawlspace leaks under the right conditions. Good maintenance of exterior grading, gutters and downspouts is critically important. For more details, please refer to Section 10 of the **Interior** chapter of the Home Reference Book, which is in the **REFERENCE** tab in this report.

Roof - Annual Maintenance

It is important to set up an annual inspection and tune-up program to minimize the risk of leakage and maximize the life of the roof. Roof leaks may occur at any time and are most often at penetrations or changes in material. A leak does not necessarily mean the roof needs to be replaced.

Roof coverings are disposable and have to be replaced from time to time. Asphalt shingles, for example, last roughly 15 years.

Exterior - Annual Maintenance

Annual inspection of the exterior is important to ensure weather-tightness and durability of exterior components. Grading around the home should slope to drain water away from the foundation to help keep the basement dry. Painting and caulking should be well maintained. Particular attention should be paid to horizontal surfaces where water may collect. Joints, intersections, penetrations and other places where water may enter the building assembly should be checked and maintained regularly.

APPEI	APPENDIX Report No. 56013								
15 Sunnyl	ea Ave E, To	pronto, ON	November 9, 2016 www.carsondunlop.c						ndunlop.com
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR
APPENDIX	REFERENCE								

Garage Door Operators

The auto reverse mechanism on your garage door opener should be tested monthly. The door should also reverse when it meets reasonable resistance, or if the 'photo eye' beam is broken.

Electrical System – Label the Panel

Each circuit in the electrical panel should be labelled to indicate what it controls. This improves both safety and convenience. Where the panel is already labelled, the labelling should be verified as correct. Do not rely on existing labelling.

Ground Fault Interrupters and Arc Fault Circuit Interrupters

These should be tested monthly using the test buttons on the receptacles or on the breakers in the electrical panel.

Heating and Cooling System – Annual Maintenance

Set up an annual maintenance agreement that covers parts and labour for all heating and cooling equipment. This includes gas fireplaces and heaters, as well as furnaces, boilers and air conditioners. Include humidifiers and electronic air cleaners in the service agreement. Arrange the first visit as soon as possible after taking possession.

Check filters for furnaces and air conditioners monthly and change or clean as needed. Duct systems have to be balanced to maximize comfort and efficiency, and to minimize operating costs. Adjust the balancing for heating and cooling seasons, respectively.

For hot water systems, balancing should be done by a specialist to due to the risk of leakage at radiator valves. These valves are not operated during a home inspection.

Bathtub and Shower Maintenance

Caulking and grout in bathtubs and showers should be checked every 6 months, and improved as necessary to prevent leakage and water damage behind walls and below floors.

Water Heaters

All water heaters should be flushed by a specialist every year to maximize performance and life expectancy. This is even more critical on tankless water heaters.

APPENDIX							Report	No. 56013		
15 Sunnylea Ave E, Toronto, ON			November 9, 2016 www.carson					ndunlop.com		
OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBING	INTERIOR	l
APPENDIX	REFERENCE									

Washing Machine Hoses

We suggest braided steel hoses rather than rubber hoses for connecting washing machines to supply piping in the home. A ruptured hose can result in serious water damage in a short time, especially if the laundry area is in or above a finished part of the home.

Clothes Dryer Vents

We recommend that vents for clothes dryers discharge outside the home. The vent material should be smooth walled (not corrugated) metal, and the run should be as short and straight as practical. This reduces energy consumption and cost, as well as drying time for clothes. It also minimizes the risk of a lint fire inside the vent.

Lint filters in the dryer should be cleaned every time the dryer is used. There is a secondary lint trap in many condominiums. These should be cleaned regularly. There may also a duct fan controlled by a wall switch. The fan should be ON whenever the dryer is used.

Dryer ducts should be inspected annually and cleaned as necessary to help reduce the risk of a fire, improve energy efficiency and reduce drying times.

Fireplace and Wood Stove Maintenance

Wood burning appliances and chimneys should be inspected and cleaned before you use them, and annually thereafter. We recommend that specialists with a WETT (Wood Energy Technology Transfer, Inc.) designation perform this work. Many insurance companies require a WETT inspection for a property with a wood burning device.

Smoke and Carbon Monoxide (CO) Detectors

Smoke detectors are required at every floor level of every home, including basements and crawlspaces. Even if these are present when you move into the home, we recommend replacing the detectors. Carbon monoxide detectors should be provided adjacent to all sleeping areas.

These devices are not tested during a home inspection. Detectors should be tested every 6 months, and replaced every 10 years. Batteries for smoke and carbon monoxide detectors should be replaced annually. If unsure of the age of a smoke detector, it should be replaced.

APPENDIX			Report No. 56013
15 Sunnylea Ave E, Toronto, ON	November 9, 2016		www.carsondunlop.com
OVERVIEW ROOFING EXTERIOR	STRUCTURE ELECTRICAL HEATING	COOLING INSULATION	PLUMBING INTERIOR
APPENDIX REFERENCE			
	This is a copy of our home inspection con	tract and outlines	
	the terms, limitations and conditions of th	e home inspection	
THIS CONTRACT LIMITS TH	E LIABILITY OF THE HOME INSPECTION COMPA	NY.	
PLEASE READ CAREFULLY E	EFORE SIGNING.		
The term Home Inspecto	r in this document means the Home Inspect	or and the Home Inspection Com	pany. The
	accordance with the STANDARDS OF PRACTICE of	of the Ontario Association of Home Ir	nspectors.
To review the STANDARDS	OF PRACTICE, Click <u>here</u> .		
	rt is an opinion of the present condition of the p of the building. For more information on what a		
	-		
out in this Agreement.	is in the STANDARDS, the Inspection of this prop	erty is subject to Limitations and Cor	laitions set
LIMITATIONS AND CONDITI	ONS OF THE HOME INSPECTION		
The focus of the inspection	is on major issues that may affect a reasonable	person's decision to buy a home.	
	ralist, rather than a specialist. The home inspect		view rether
	e Inspectors do not perform calculations to deter		
structural systems for exam	ple, are properly sized.		
1) THE INSPECTION IS NOT	TECHNICALLY EXHAUSTIVE.		
	g exercise and is not technically exhaustive. The		
major issues, we typically c understood that not all issu	ome across some smaller issues. These are inclu ies will be identified.	ded in the report as a courtesy, but it	should be
Establishing the significance	e of an issue may be beyond the scope of the ins	nection Eurther evaluation by a snee	rialist may
be required.			
A Technical Audit is a more	in-depth, technically exhaustive inspection of th	e home that provides more informat	tion than a
	both services available. By accepting this agreen	nent, you acknowledge that you have	e chosen a
Home Inspection instead of			
You also acknowledge that water problems.	you have been offered and have declined a ther	mal imaging inspection to help ident	ify hidden
If you are concerned about	any conditions noted in the Home Inspection Re	port, we strongly recommend that y	ou consult a
qualified specialist to provi	de a more detailed analysis.		

APPENDIX	Report No. 56013
15 Sunnylea Ave E, Toronto, ON November 9, 2016	www.carsondunlop.com
OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION	PLUMBING INTERIOR
2) THE INSPECTION IS AN OPINION OF THE PRESENT CONDITION OF THE VISIBLE COMPONENTS.	
A Home Inspection does not include identifying defects that are hidden behind walls, floors or ceilings. This incl inaccessible elements such as wiring, heating, cooling, structure, plumbing and insulation.	udes
Some intermittent problems may not be detectable on a Home Inspection because they only happen under cer circumstances. For example, your Home Inspector may not discover leaks that occur only during certain weather or when a specific tap or appliance is being used in everyday life.	
Home Inspectors will not find conditions that are concealed by finishes, storage or furnishings. Inspectors do n wall coverings (including wallpaper), lift flooring (including carpet) or move storage or furniture.	t remove
3) THIS IS NOT A CODE-COMPLIANCE INSPECTION	
Home Inspectors do NOT determine whether or not any aspect of the property complies with past or present c as building codes, electrical codes, fuel codes, fire codes, etc.), regulations, laws, by-laws, ordinances or other r requirements. Codes change regularly, and most homes will not comply with current codes.	
4) THE INSPECTION DOES NOT INCLUDE HAZARDOUS MATERIALS.	
This includes building materials that are now suspected of posing a risk to health such as phenol-formaldehyde formaldehyde based insulation, fiberglass insulation and vermiculite insulation. Inspectors do NOT identify asbe roofing, siding, wall, ceiling or floor finishes, insulation or fireproofing. Inspectors do NOT look for lead or other in such things as pipes, paint or window coverings. Health scientists can help in these areas.	estos in
The Inspection does not deal with environmental hazards such as the past use of insecticides, fungicides, herbic pesticides. Home Inspectors do NOT look for, or comment on, the past use of chemical termite treatments in or property.	
5) WE DO NOT COMMENT ON THE QUALITY OF AIR IN A BUILDING.	
The Inspector does not determine if there are irritants, pollutants, contaminants, or toxic materials in or around building.	l the
The Inspection does not include spores, fungus, mould or mildew. You should note that whenever there is wate noted in the report, there is a possibility that mould or mildew may be present, unseen behind a wall, floor or c	
If anyone in your home suffers from allergies or heightened sensitivity to quality of air, we strongly recommen consult a qualified Environmental Consultant who can test for toxic materials, mould and allergens at additiona	•
6) WE DON'T LOOK FOR BURIED TANKS.	
Home Inspectors do not look for fuel oil, septic or gasoline tanks that may be buried on the property. If there an other storage tanks on the property, you may be responsible for their removal and the safe disposal of any con- soil. If you suspect there is a buried tank, we strongly recommend that you retain a qualified Environmental Con investigate.	aminated

APPENDIX	Report No. 56013
15 Sunnylea Ave E, Toronto, ON November 9, 2016	www.carsondunlop.com
OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSU	ILATION PLUMBING INTERIOR
APPENDIX REFERENCE	
7) CANCELLATION FEE	
If the inspection is cancelled within 24 hours of the appointment time, a cancellation fee of 50% of the	fee will apply.
8) REPORT IS FOR OUR CLIENT ONLY.	
The inspection report is for the exclusive use of the client named herein. The client may provide the re buyers, at their own discretion. Potential buyers are required to obtain their own Onsite Review with 0 intend to rely on this report. Carson Dunlop will not be responsible for the use of or reliance upon this party without an Onsite Review.	Carson Dunlop if they
9) NOT A GUARANTEE, WARRANTY OR INSURANCE POLICY.	
The inspection and report are not a guarantee, warranty or an insurance policy with regard to the fitne home warranty is available. For more information, visit <u>www.carsondunlop.com/home-inspection/hom</u>	
10) TIME TO INVESTIGATE	
We will have no liability for any claim or complaint if conditions have been disturbed, altered, repaired otherwise changed before we have had a reasonable period of time to investigate.	, replaced or
11) LIMIT OF LIABILITY	
THE LIABILITY OF THE HOME INSPECTOR AND THE HOME INSPECTION COMPANY ARISING OUT OF THIS REPORT, FOR ANY CAUSE OF ACTION WHATSOEVER, WHETHER IN CONTRACT OR IN NEGLIGENCE, IS LII OF THE FEES THAT YOU HAVE BEEN CHARGED FOR THIS INSPECTION OR \$1,000, WHICHEVER IS GREATI	MITED TO A REFUND
12) TIME PERIOD	
The Client acknowledges and agrees that the timeframe for commencement of legal proceedings by th Inspector for damages suffered by the Client as a result of alleged errors, omissions, breaches of contra by the Inspector shall not be later than two (2) years from the date of the inspection.	
13) LEGAL ADVICE	
The Client has had such legal advice as the Client desires in relation to the effect of this Contract on the	e Client's legal rights.
14) CLIENT'S AGREEMENT	
The Client understands and agrees to be bound by each and every provision of this contract. The Client bind any other family members or other interested parties to this Contract.	: has the authority to

APPENDIX 15 Sunnylea Ave E, Toronto, ON November 9, 2016 www.carsondunlop.com OVERVIEW ROOFING EXTERIOR STRUCTURE ELECTRICAL HEATING COOLING INSULATION PLUMBING INTERIOR APPENDIX REFERENCE REFERENCE VWW.carsondunlop.com VWW.carsondunlop.com VWW.carsondunlop.com





As a Carson Dunlop client, you recieve complimentary membership. Membership benefits are included below.

- Free Home Reference Book (\$59 value). Helps you look after your home.

- Free RecallChek report and subscription (\$25 value). Notifies you of safety recalls on your furnace, air conditioner, water heater and appliances.

- Free HomeVerified report (\$69 value). Provides insurance claims history for the home, neighbourhood profile, gow op and meth lab history, school rankings, neighbourhood amenities, etc.

- Discounts and preferred pricing from our Association partners - see below.











HOME WARRANTY & PROTECTION

Our warranty protects you from the high cost of repair due to breakdown of home systems and appliances. Three levels of protection to choose from. Click to learn more. Our home inspection identifies the present condition of the home. Our warranty protects you in the future.

HOME INSURANCE PARTNERS

David Slack Insurance Brokers has a group rate for Association members. Save 15 to 30% on your home and auto insurance. Special considerations for older homes. 800-971-1363 or email David@Davidslackinsurance.com.

JUNK REMOVAL Association members receive a \$50 gift card toward junk removal services. Enter the promo code: Carson 50 at: www.1800gotjunk.com.

HVAC SYSTEMS

Our heating and air-conditioning partner, AtlasCare specializes in high efficiency funaces, central air conditioning, boilers, fireplaces, air filters, humidifiers, duct cleaning and other comfort products and services. Association members receive exclusive discounts. Visit www.Atlascare.ca and quote Carson Dunlop.

LIFESTYLE DISCOUNTS

Perkopolis has provided us with very attractive discounts and offers for sports and entertainment tickets, hotel packages, travel deals, attractions, and even everyday items, such as clothing, automotive, home TV and other home services. To learn more or to register for free, please visit perkopolis.com/PerkLaunchpages/CarsonDunlopHomeownersAssociation. Please enter the following promo code when registering: CARSONHA



APPENDIX

APPENDIX

Report No. 56013 www.carsondunlop.com

15 Sunnylea Ave E, Toronto, ON November 9, 2016

		,	,		,				
	OVERVIEW	ROOFING	EXTERIOR	STRUCTURE	ELECTRICAL	HEATING	COOLING	INSULATION	PLUMBIN
1									

REFERENCE











) Insurance

MOVING & PACKING SERVICES

Customers receive 15% off their packing supply requirements and 10% off our local moving rates. To use your discount, simply call 1-888-AMJ-MOVE and quote offer code "Carson Dunlop" when booking. For the packing supply discount, simply go to www.amjboxes.com and enter the code "cdunlop". To learn more about this partner, visit amjcampbell.com.

CAR & TRUCK RENTAL

Discount Car & Truck Rentals is proud to offer customers 10% off their car and truck rentals. To use your discount, simply use the on-line booking system when scheduling your rental and enter the code "HOMEOWNER" in the discount section. To learn more about this partner, visit discountcar.com.

PEST & WILDLIFE CONTROL

Orkin is pleased to offer customers with a 20% discount when booking a termite control or pest control treatment. 1.800.800.6754 to book their service and state you are a Carson Dunlop client to obtain your discount.

PLUMBING AND DRAIN SERVICES

Customers receive a \$50 discount towards plumbing, drain, sewer and water proofing services. To learn more about this partner, visit rotorootergta.ca/roto-rooter-gta/get-coupons

HOME SECURITY SYSTEM

ADT Security Services is a leading provider of electronic security, interactive home and business automation and alarm monitoring services in Canada and America. They deliver an integrated customer experience by maintaining the industry's largest sales,installation, and service field force and most robust monitoring network, all backed by the support of nearly 16,000 employees. Their broad and pioneering set of products and services –from interactive home and business solutions to home health services – meet a range of customer need for today's active and increasingly mobile lifestyles. ADT Security Services is pleased to offer Homeowners Association members free installation of their Quick Connect Plus package. To redeem this offer, please call 1-888-556-6608 and quote promotional code A103857.

MORTGAGE RATE SERVICE

Ratesheet.ca is a website that connects users shopping for the best mortgage rates with local mortgage brokers using their Comprehensive Mortgage Quote system. Ratesheet.ca features a Mortgage Rate Search, a sophisticated calculator, and an interactive Map Search to help users locate ideal mortgage brokers and rates. Ratesheet.ca brings to life some incredible features to help users find their ideal mortgage broker and rates. This valuable service is available to Carson Dunlop clients for free. To learn more please visit http://www.ratesheet.ca.

HOME & AUTO INSURANCE

Receive a preferred rate when using TD Insurance for home or auto insurance. The ability to obtain insurance coverage at a preferred rate is what makes this program a real value add, especially for homes that are older. To learn more about these savings, visit: http://www.mytdiservice.com/en/group/carson.



Powered by Knowledge

Page 30 of 32

APPENDIX 15 Sunnylea Ave E, Toronto, ON November 9, 2016 overview Roofing exterior Structure electrical Heating Cooling Insulation APPENDIX	Report No. 56013 www.carsondunlop.com PLUMBING INTERIOR							
ASBESTOS, MOULD AND OTHER ENVIRONMENTAL ISSUES Environmental issues are outside the scope of a home inspection.								
Inspectors do not identify or evaluate issues such as asbestos, mould and indoor air quality. Many building materials contain asbestos, although homes built after 1990 are unlikely to have asbestos. Moist problems may result in visible or concealed mould. There are many sources of indoor air quality issues.								
An Environmental Consultant can assist with these types of issues. If you need help, call us at 416-964-9415. More information is available by clicking on the links below. ASBESTOS								
Health Risks of Asbestos - Government of Canada VERMICULITE Vermiculite Insulation Containing Amphibole Asbestos Vermiculite Insulation Containing Amphibole Asbestos - Health Canada	da							
MOULD MOISTURE AND AIR A Guide for Understanding and Fixing Interior Moisture Problems in Housing - Canada Mortgage and Housing Corporation								
AIR QUALITY Indoor Air Quality - Health Canada								

Report No. 56013 REFERENCE LIBRARY www.carsondunlop.com 15 Sunnylea Ave E, Toronto, ON November 9, 2016 ROOFING STRUCTURE COOLING INSULATION PLUMBING APPENDIX REFERENCE The links below connect you to a series of documents that will help you understand your home and how it works. These are in addition to links attached to specific items in the report. Click on any link to read about that system. 01. ROOFING, FLASHINGS AND CHIMNEYS (\gg) 02. EXTERIOR (>>) (\gg) 03. STRUCTURE 04. ELECTRICAL (\mathcal{S}) 05. HEATING (>>) (\gg) 06. COOLING/HEAT PUMPS (\gg) 07. INSULATION (>>)08. PLUMBING (\gg) 09. INTERIOR (\gg) **10. APPLIANCES 11. LIFE CYCLES AND COSTS** >>> **12. SUPPLEMENTARY** Asbestos Radon Urea Formaldehyde Foam Insulation (UFFI) Lead Carbon Monoxide Mold Household Pests **Termites and Carpenter Ants 13. HOME SET-UP AND MAINTENANCE 14. MORE ABOUT HOME INSPECTIONS**